

General Information

Date & Time: 10, Nov, 2025 17:42

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	29,102
Registration No.	GBG2903	Chassis No.	MHKU3FE10NK002562
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Pickup
Colour	White		

Body / Panel Condition



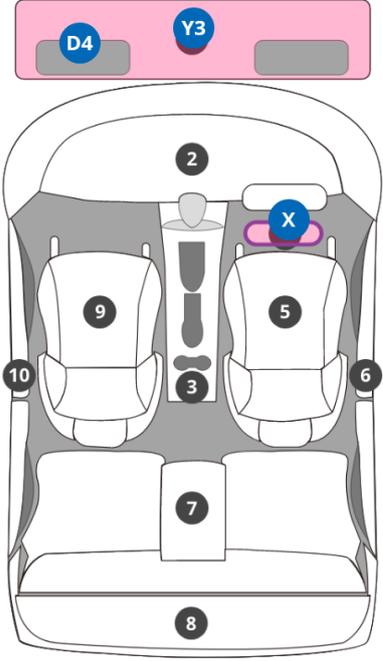
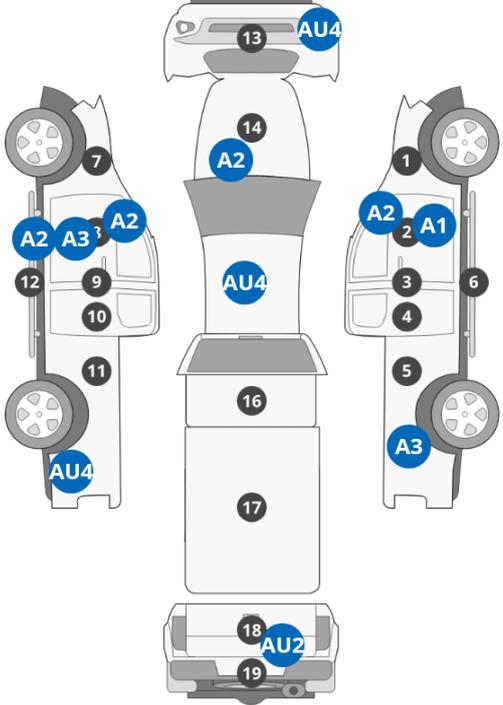
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	44.3	44	46	44
2	Boot Lid	43.5	48	40	43
3	Roof	39.5	41	39	40/39
4	Left Front Fender	34.9	31	34	40
5	Left Front Door	46.0	43	52	44
6	Center Panel Left	66.2	59	57	83
7	Left Rear Door				
8	Left Back Panel	40.2	36	47	38
9	Right Front Fender	50.3	57	49	45
10	Right Front Door	44.9	37	52	46
11	Center Panel Right	58.3	62	56	57
12	Right Rear Door				
13	Right Back Panel	37.0	39	42	30

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Loose, Deformed - Large / Mat Other - Missing - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Left sunvisor issue. Rear view mirror replaced. With warranty booklet and spare tire. Without jack and tools. 1 key. With LTO plate.</p>