

## General Information

Date & Time: 05, Nov, 2025 21:41

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	43,398
<b>Registration No.</b>	HAH3170	<b>Chassis No.</b>	PA1B18F30R4243971
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



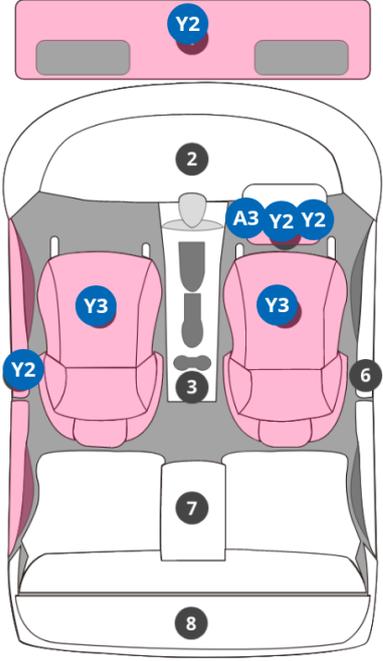
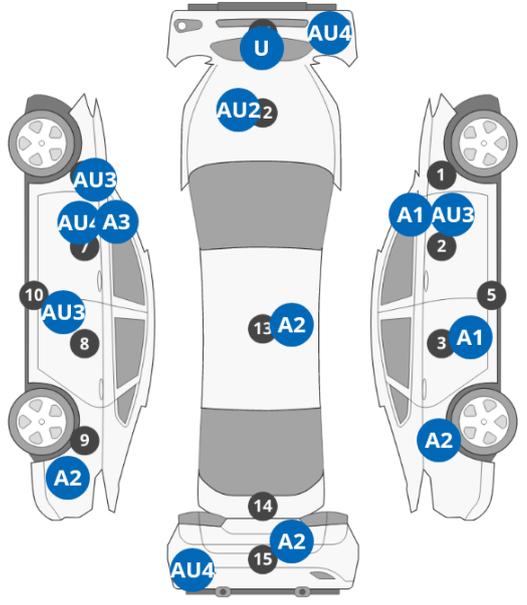
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	108	96	104
2	Boot Lid	94.3	95	91	97
3	Roof	96.7	95	105	91/96
4	Left Front Fender	89.5	91	86	92
5	Left Front Door	90.6	92	91	89
6	Center Panel Left				
7	Left Rear Door	97.0	102	98	91
8	Left Back Panel	100.0	105	99	97
9	Right Front Fender	103.3	103	101	106
10	Right Front Door	97.0	102	93	96
11	Center Panel Right				
12	Right Rear Door	100.5	92	100	110
13	Right Back Panel	102.5	105	100	103

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Medium</p>	<p><b>Remarks</b>          Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
<p><b>Remarks</b>          Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b>          Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Damaged front bumper. Right front fender cover loose. Without warranty booklet, tools and seat cover. With spare tire and jack. 1 key. With LTO plate.</p>