

General Information

Date & Time: 14, Nov, 2025 13:52

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	19,210
Registration No.	GBE5314	Chassis No.	MHFAA1BY8R0026230
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



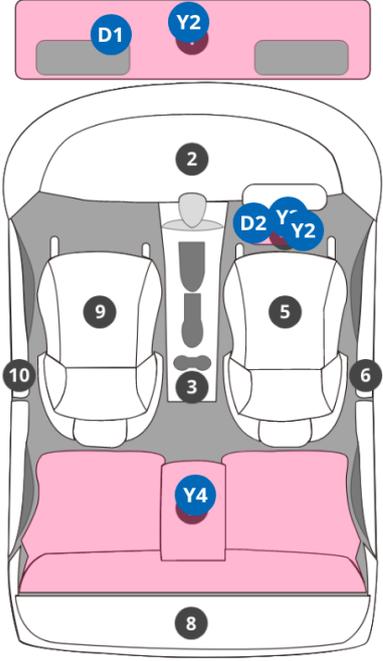
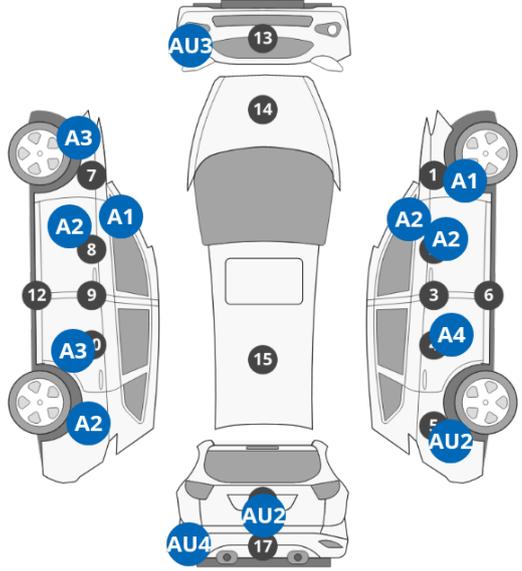
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.9	100	115	109
2	Boot Lid	99.0	101	101	95
3	Roof	110.0	114	118	107/101
4	Left Front Fender	97.0	98	96	97
5	Left Front Door	110.3	101	112	118
6	Center Panel Left				
7	Left Rear Door	107.0	108	105	108
8	Left Back Panel	104.5	115	105	94
9	Right Front Fender	99.3	104	98	96
10	Right Front Door	109.3	117	111	100
11	Center Panel Right				
12	Right Rear Door	109.3	114	105	109
13	Right Back Panel	101.7	94	97	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Rear Seat - Grime - Large / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Crinkle - Minimal</p>		<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. No LTO plate.