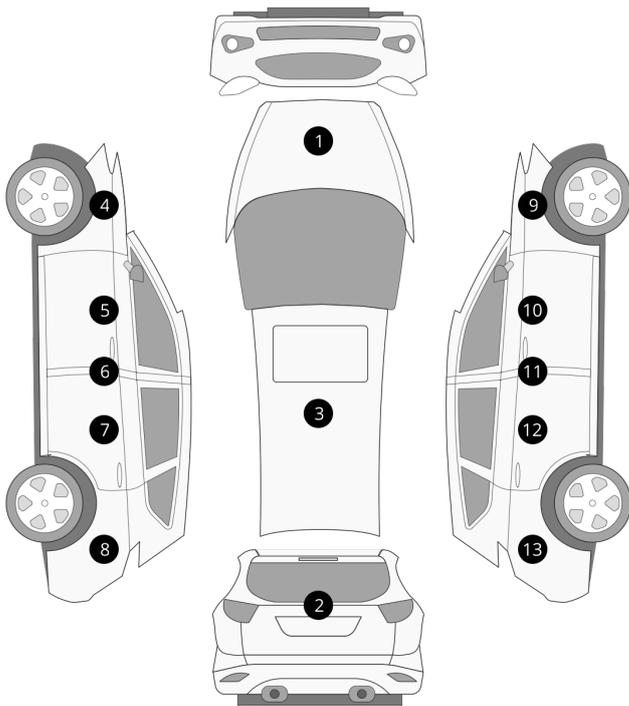


## General Information

Date & Time: 10, Nov, 2025 17:44

<b>Make</b>	Toyota	<b>Model</b>	Yaris Cross
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	13,132
<b>Registration No.</b>	GBE5930	<b>Chassis No.</b>	MHFAA8AF3R0025480
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Black		

## Body / Panel Condition



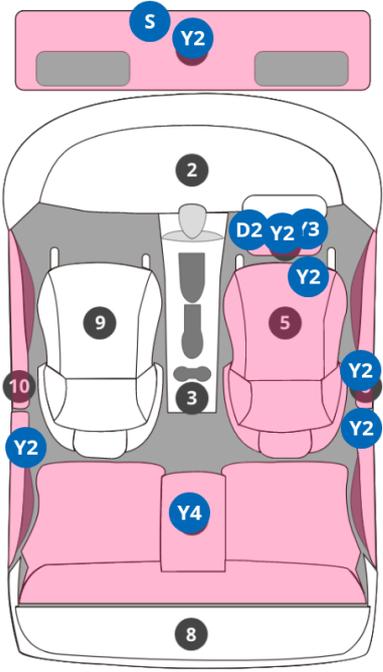
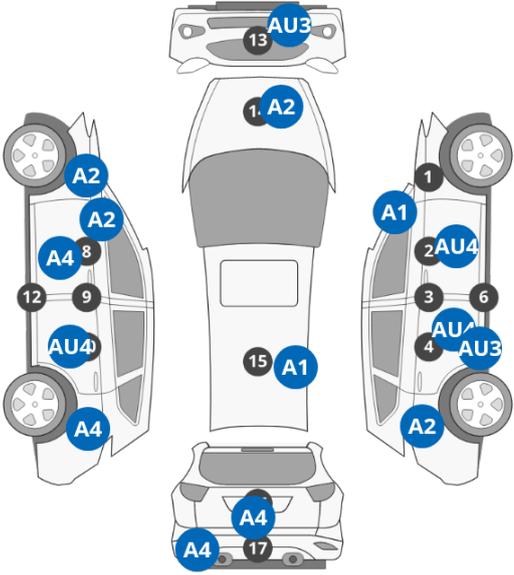
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.8	112	100	112
2	Boot Lid	103.4	127	97	87
3	Roof	112.7	111	111	117/112
4	Left Front Fender	105.3	109	100	107
5	Left Front Door	101.3	90	104	110
6	Center Panel Left				
7	Left Rear Door	104.1	112	99	101
8	Left Back Panel	110.6	118	105	109
9	Right Front Fender	100.3	106	96	100
10	Right Front Door	108.0	114	106	104
11	Center Panel Right				
12	Right Rear Door	104.9	108	100	107
13	Right Back Panel	109.3	113	103	112

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Large / Mat Other - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet and spare tire. without jack,tools and sest cover. 1 key. No LTO plate.</p>