

General Information

Date & Time: 01, Dec, 2025 15:05

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	87,364
Registration No.	GAO8519	Chassis No.	PA1B18F35L4117208
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



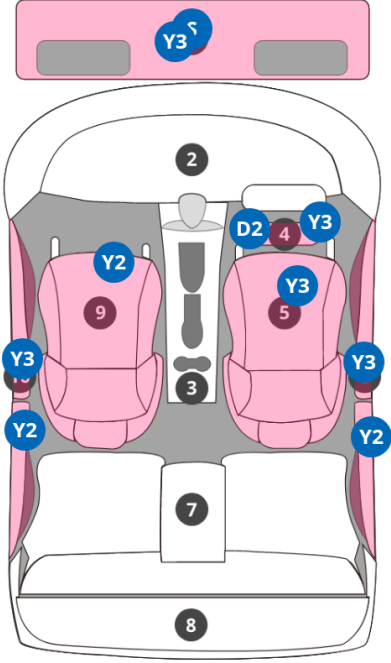
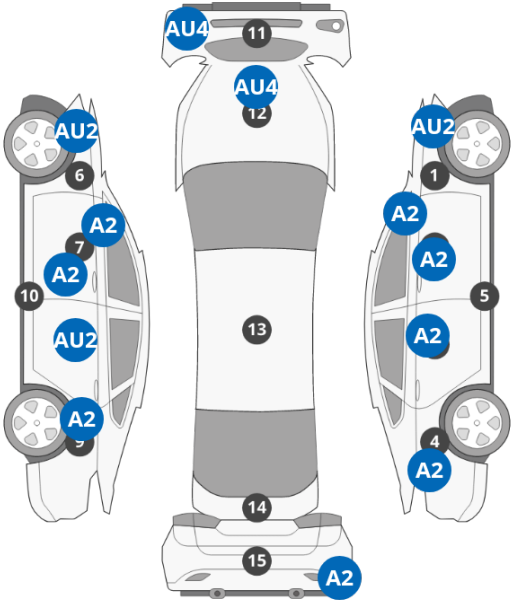
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	119	108	114
2	Boot Lid	111.0	107	113	113
3	Roof	94.5	98	91	91/98
4	Left Front Fender	95.1	98	92	96
5	Left Front Door	97.1	103	99	89
6	Center Panel Left				
7	Left Rear Door	103.6	102	104	105
8	Left Back Panel	106.6	112	103	105
9	Right Front Fender	93.0	96	89	94
10	Right Front Door	97.8	102	97	94
11	Center Panel Right				
12	Right Rear Door	103.4	102	99	109
13	Right Back Panel	105.0	101	99	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Medium</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Non moving unit. All warning lamps present. All electrical function issue. Possible flooding. With warranty booklet, spare tire. Without jack, tools, seat cover. 3 keys. With LTO plate.</p>