

General Information

Date & Time: 24, Nov, 2025 10:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	33,781
Registration No.	GBD8479	Chassis No.	PA1B18F36R4270012
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



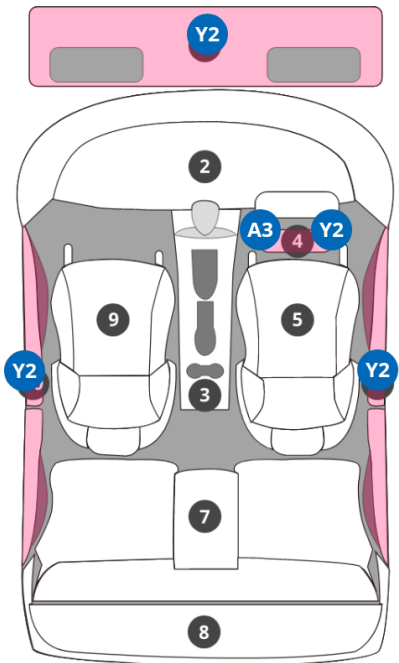
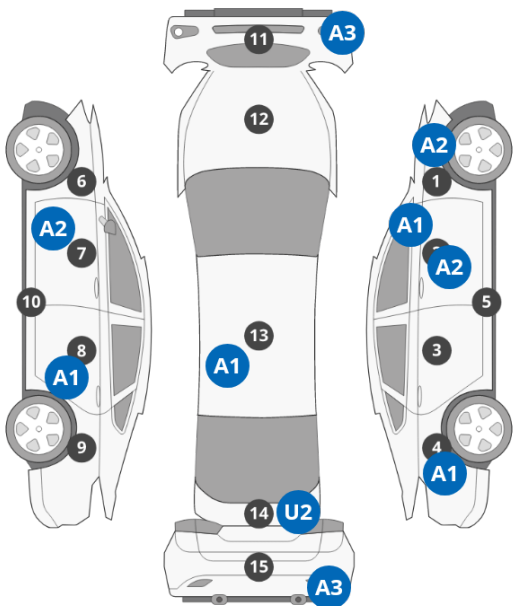
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	112	110	119
2	Boot Lid	118.0	115	116	123
3	Roof	94.7	98	89	95/97
4	Left Front Fender	101.5	110	98	97
5	Left Front Door	104.3	102	100	111
6	Center Panel Left				
7	Left Rear Door	105.0	113	103	99
8	Left Back Panel	112.3	116	110	111
9	Right Front Fender	96.4	97	89	104
10	Right Front Door	97.2	98	90	104
11	Center Panel Right				
12	Right Rear Door	100.0	96	98	107
13	Right Back Panel	106.6	104	101	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium</p>	<p>Remarks (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate.</p>