

General Information

Date & Time: 26, Jan, 2026 12:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,835
Registration No.	GBI2319	Chassis No.	PA1B18F34R4277346
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



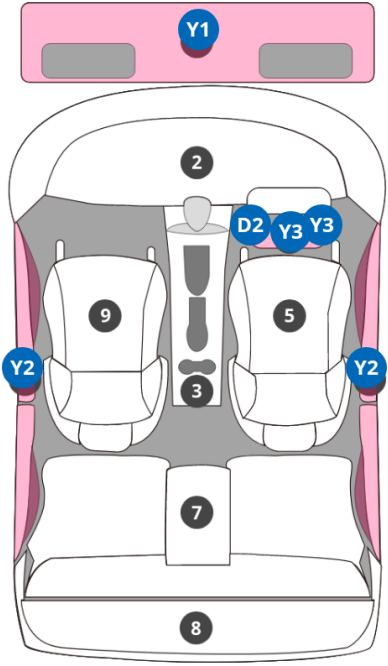
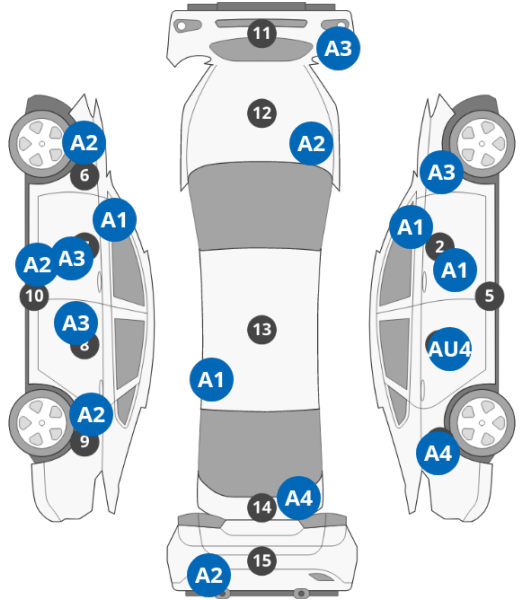
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	109	110	110
2	Boot Lid	109.0	100	110	117
3	Roof	99.3	111	99	89/98
4	Left Front Fender	96.3	100	95	95
5	Left Front Door	105.3	100	111	105
6	Center Panel Left				
7	Left Rear Door	109.3	110	108	110
8	Left Back Panel	104.0	97	108	107
9	Right Front Fender	95.9	89	100	99
10	Right Front Door	98.4	99	99	98
11	Center Panel Right				
12	Right Rear Door	100.1	96	101	104
13	Right Back Panel	109.0	105	107	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>Possible flooding. Temporary CR. With warranty booklet, spare tire, jack and seat cover. Incomplete tools. 2 keys. No LTO plate.</p>