

General Information

Date & Time: 05, Nov, 2025 21:33

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	37,088
Registration No.	GAK8596	Chassis No.	PA1B18F39P4212277
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



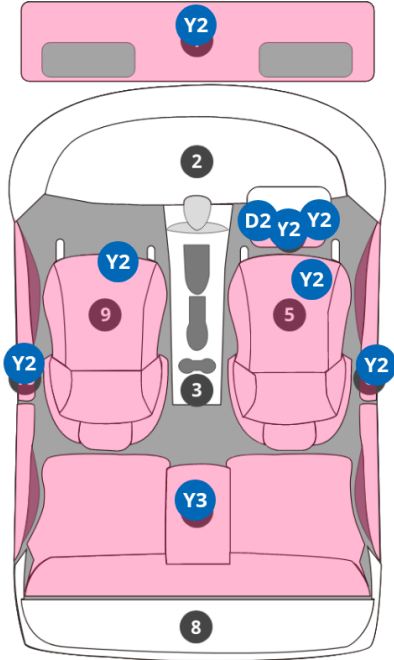
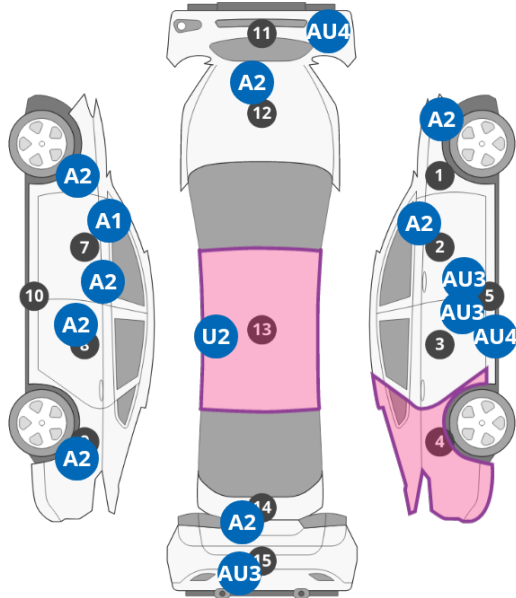
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.8	104	92	104
2	Boot Lid	96.8	93	95	102
3	Roof	137.5	134	134	143/139
4	Left Front Fender	84.3	85	84	84
5	Left Front Door	123.3	114	120	136
6	Center Panel Left				
7	Left Rear Door	127.6	146	124	113
8	Left Back Panel	96.2	99	86	104
9	Right Front Fender	117.6	119	119	115
10	Right Front Door	123.0	138	111	120
11	Center Panel Right				
12	Right Rear Door	171.0	164	164	185
13	Right Back Panel	144.0	123	125	184

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Gap at front bumper. With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. No LTO plate.</p>