

General Information

Date & Time: 21, Nov, 2025 15:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,673
Registration No.	GBC3023	Chassis No.	PA1B18F31P4232782
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



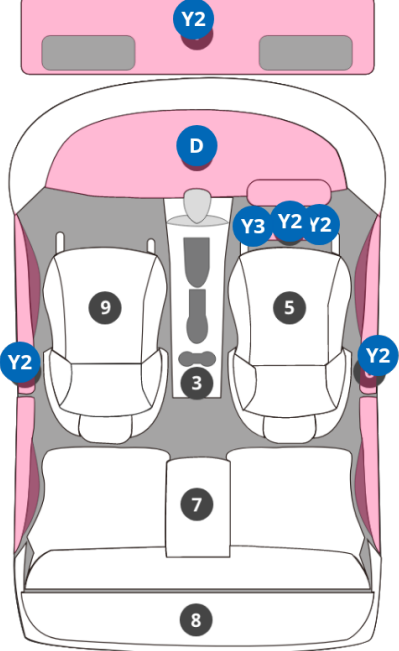
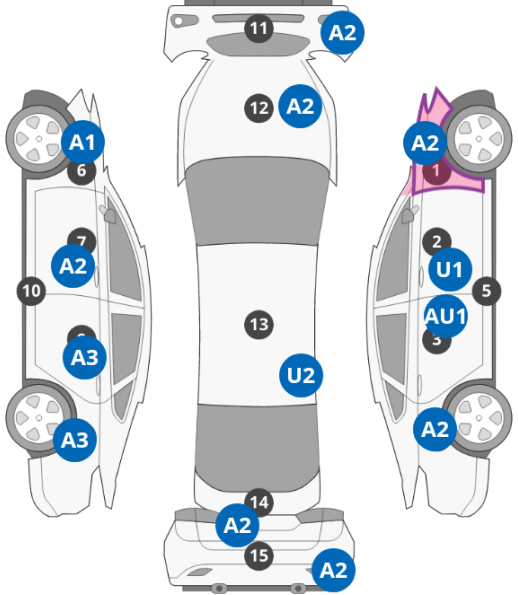
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	103	108	108
2	Boot Lid	108.6	107	105	114
3	Roof	100.1	97	109	95/100
4	Left Front Fender	106.6	111	108	101
5	Left Front Door	100.7	93	102	107
6	Center Panel Left				
7	Left Rear Door	106.0	107	108	103
8	Left Back Panel	110.6	122	107	103
9	Right Front Fender	98.2	97	94	104
10	Right Front Door	102.3	98	109	100
11	Center Panel Right				
12	Right Rear Door	100.0	100	97	103
13	Right Back Panel	105.2	101	100	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Wheel, Cover - Cap Missing - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire, jack, and leather seat cover. Without tools. 1 key. With LTO plate.</p>