

General Information

Date & Time: 09, Oct, 2025 15:53

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	41,573
Registration No.	NBT1028	Chassis No.	PA1B13F37K4079627
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



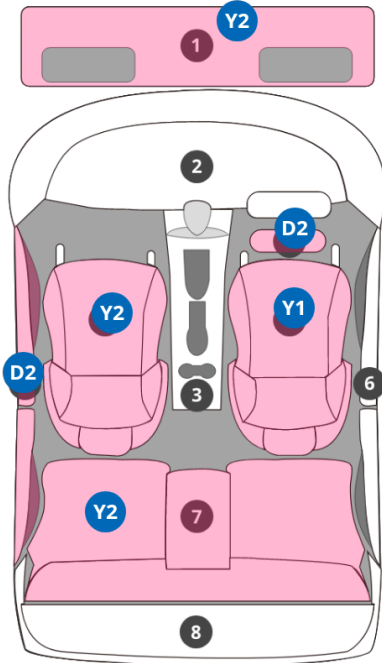
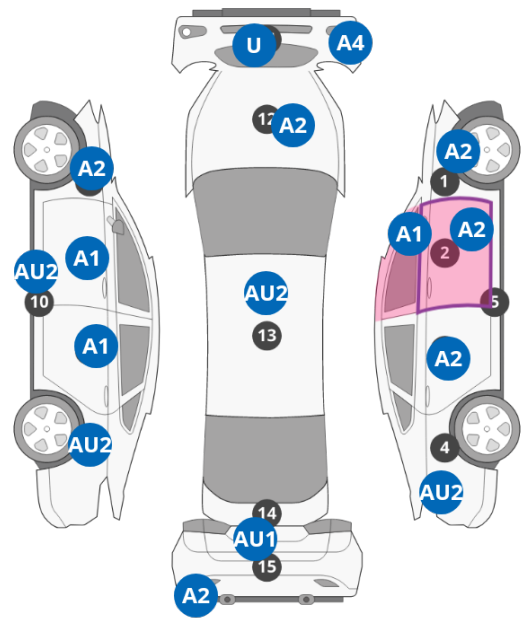
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	125	118	138
2	Boot Lid	117.6	124	107	122
3	Roof	88.8	93	91	86/86
4	Left Front Fender	134.3	134	175	94
5	Left Front Door	94.3	91	94	98
6	Center Panel Left				
7	Left Rear Door	122.6	126	114	128
8	Left Back Panel	151.3	164	139	151
9	Right Front Fender	119.0	128	101	128
10	Right Front Door	231.3	210	243	241
11	Center Panel Right				
12	Right Rear Door	129.3	126	125	137
13	Right Back Panel	126.6	121	122	137

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Small / (L) Front Trim - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
No LTO plate, Jack and Tools, No warranty booklet and Spare tire, Scratch headlight and tail light, no spare key, worn tires.