

General Information

Date & Time: 15, Oct, 2025 13:29

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	26,499
Registration No.	DBF7776	Chassis No.	MHKU3FE10RK007148
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



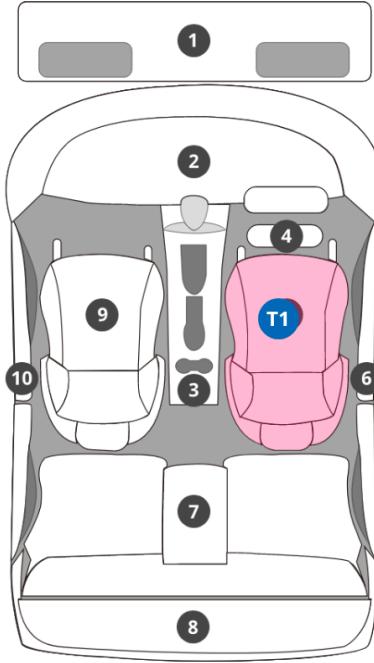
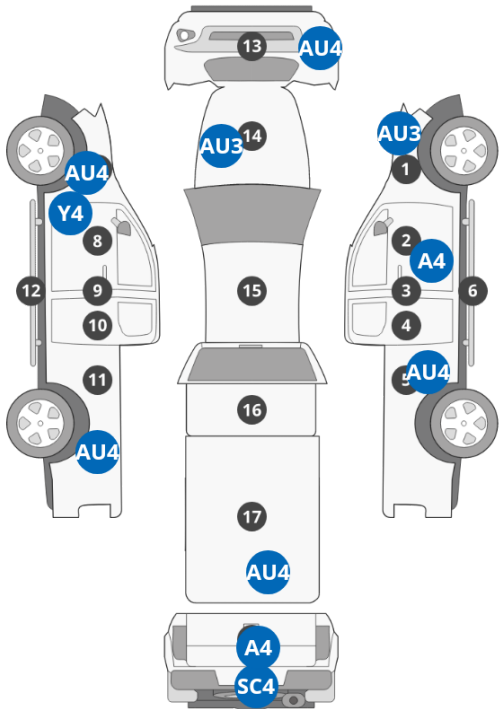
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	55.4	49	62	56
2	Boot Lid	95.8	112	110	65
3	Roof	56.7	49	64	50/64
4	Left Front Fender	59.7	57	59	64
5	Left Front Door	60.2	63	58	60
6	Center Panel Left	63.1	75	59	56
7	Left Rear Door				
8	Left Back Panel	73.2	67	89	64
9	Right Front Fender	59.6	62	54	63
10	Right Front Door	55.9	52	59	57
11	Center Panel Right	60.5	57	61	64
12	Right Rear Door				
13	Right Back Panel	67.8	60	73	71

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Cigarette Burns - Burnt Minimal / Overall Interior - Worn as per age - Yes	Remarks (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Door, Molding - Crack, Gap - Large / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / Cargo Bed Floor - Scratch & Dent - Large / Rear Gate - Scratch - Large / (R) Side Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet and LTO plate/ with spare tire and jack/ with tools
