

General Information

Date & Time: 15, Oct, 2025 13:21

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	25,119
Registration No.	DBN1967	Chassis No.	MHKAA1BC7PJ006614
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



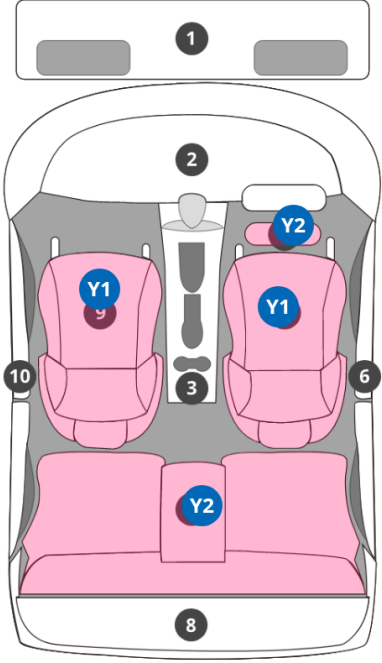
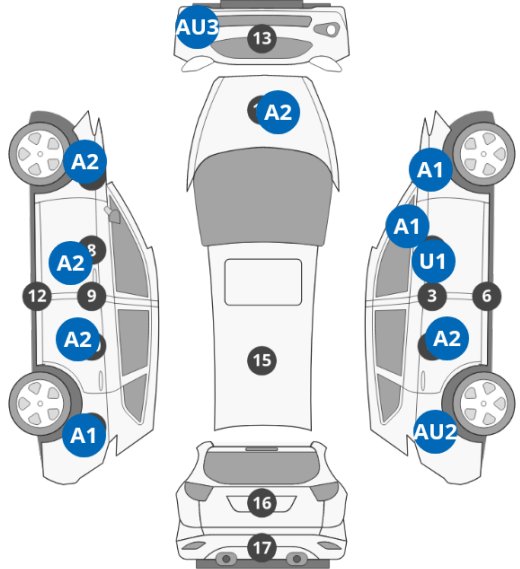
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	106	107	110
2	Boot Lid	88.9	84	93	90
3	Roof	82.0	81	87	82/78
4	Left Front Fender	102.3	91	109	107
5	Left Front Door	116.6	109	113	128
6	Center Panel Left				
7	Left Rear Door	110.1	130	102	98
8	Left Back Panel	95.8	97	93	97
9	Right Front Fender	94.3	105	95	83
10	Right Front Door	106.6	115	105	100
11	Center Panel Right				
12	Right Rear Door	103.8	98	101	112
13	Right Back Panel	97.0	109	92	90

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Minimal	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with reverse camera/No spare key/No warranty booklet