

General Information

Date & Time: 15, Oct, 2025 18:12

Make	Suzuki	Model	S-Presso
YOM	2024	Odo Meter Reading	8,350
Registration No.	NKA5553	Chassis No.	MA3FL61S6RA481512
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



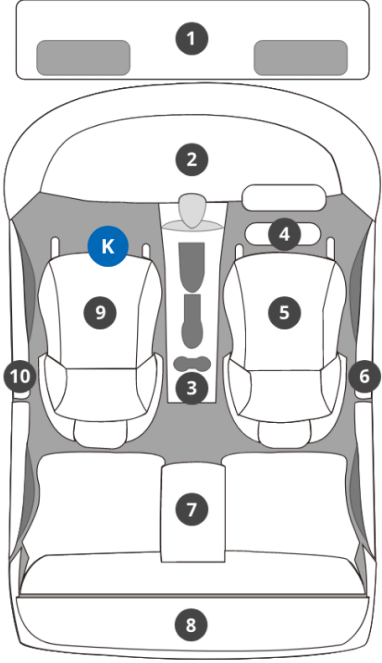
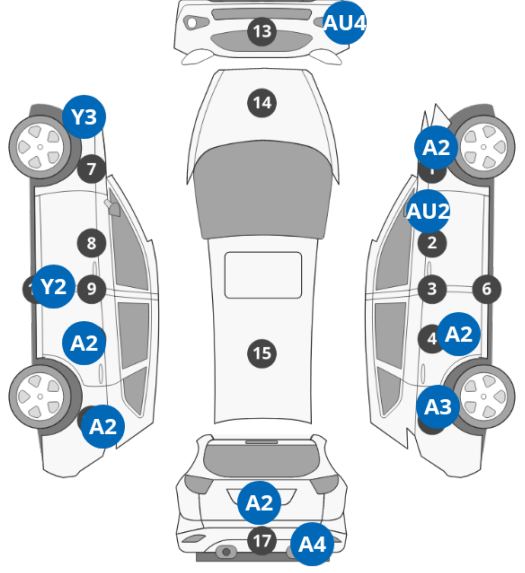
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	116	114	112
2	Boot Lid	99.4	90	106	102
3	Roof	105.9	119	100	102/103
4	Left Front Fender	97.6	97	94	102
5	Left Front Door	116.6	119	123	108
6	Center Panel Left				
7	Left Rear Door	111.0	111	113	109
8	Left Back Panel	126.0	120	127	131
9	Right Front Fender	100.3	96	103	102
10	Right Front Door	113.3	105	120	115
11	Center Panel Right				
12	Right Rear Door	111.3	118	113	103
13	Right Back Panel	117.3	119	110	123

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes	Remarks Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Front Door, Molding - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet/ with spare tire and jack/ with tools