

General Information

Date & Time: 27, Oct, 2025 18:12

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	3,533
Registration No.	BAF7476	Chassis No.	PA1B18F38P4234075
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



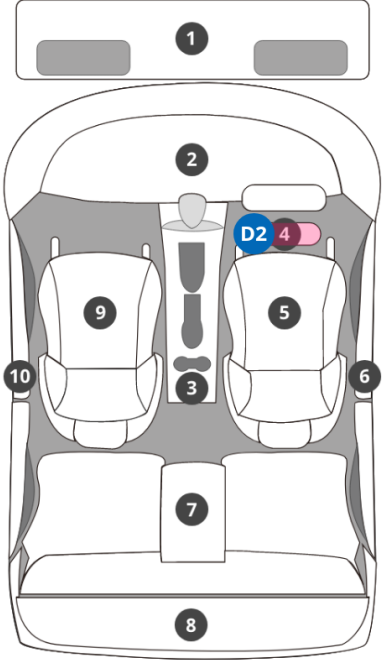
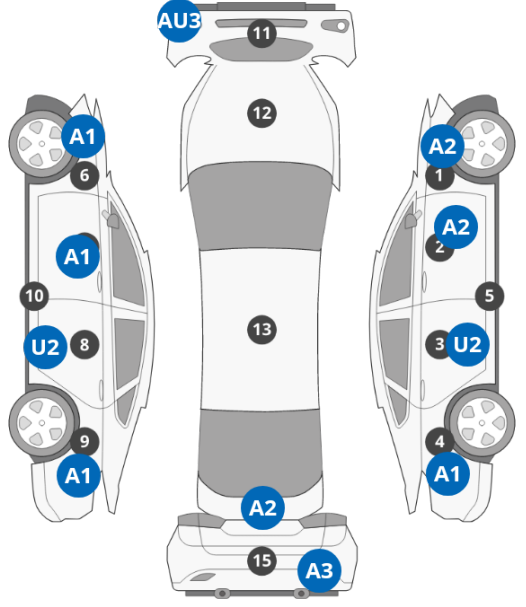
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	108	109	109
2	Boot Lid	106.0	105	105	108
3	Roof	98.6	95	99	93/107
4	Left Front Fender	94.2	94	91	98
5	Left Front Door	101.2	98	100	106
6	Center Panel Left				
7	Left Rear Door	103.6	107	102	102
8	Left Back Panel	110.0	113	113	104
9	Right Front Fender	102.6	100	102	106
10	Right Front Door	106.3	107	107	105
11	Center Panel Right				
12	Right Rear Door	104.3	109	100	104
13	Right Back Panel	106.6	98	98	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small	Remarks Rear Bumper, Lamps, Panels - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with spare tire and jack/ with tools/ no LTO plate