

General Information

Date & Time: 10, Oct, 2025 16:06

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	31,717
Registration No.	NFI5194	Chassis No.	PA1B18F32M4162446
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



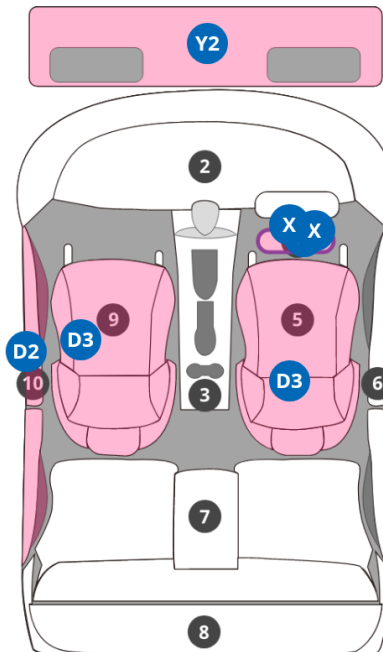
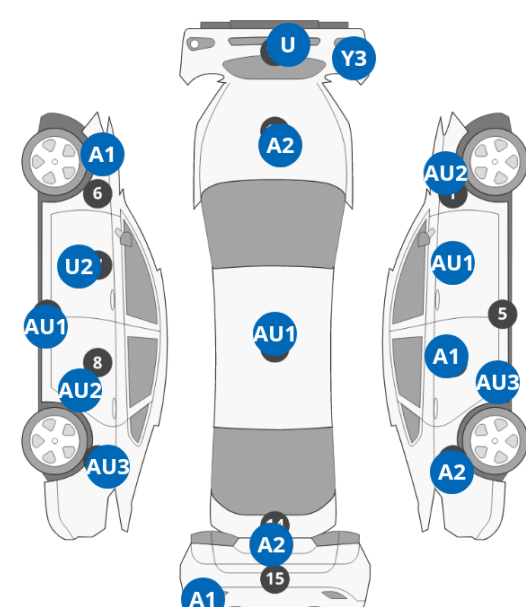
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	113	102	110
2	Boot Lid	107.6	108	102	113
3	Roof	87.1	89	88	81/92
4	Left Front Fender	88.6	93	91	82
5	Left Front Door	94.4	96	95	93
6	Center Panel Left				
7	Left Rear Door	97.6	98	98	96
8	Left Back Panel	112.0	104	110	122
9	Right Front Fender	95.0	98	93	94
10	Right Front Door	136.0	138	135	135
11	Center Panel Right				
12	Right Rear Door	133.3	128	134	138
13	Right Back Panel	104.3	105	101	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / (L) Front Seat belt - Loose, Deformed - Medium / (R) Front Seat belt - Loose, Deformed - Medium / (L) Front Trim - Worked - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Member (Bolted) - Dent - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no reverse camera, foul smell, headlight issue, warning lamps on airbag, No spare key, Abnormal vibration on engine, seat belts missing</p>