

General Information

Date & Time: 10, Oct, 2025 15:58

Make	Toyota	Model	Rush
YOM	2019	Odo Meter Reading	46,533
Registration No.	EAD4962	Chassis No.	MHKE8FF3PKK014429
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



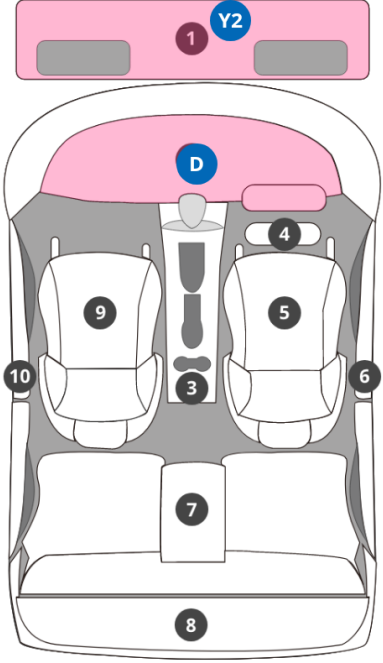
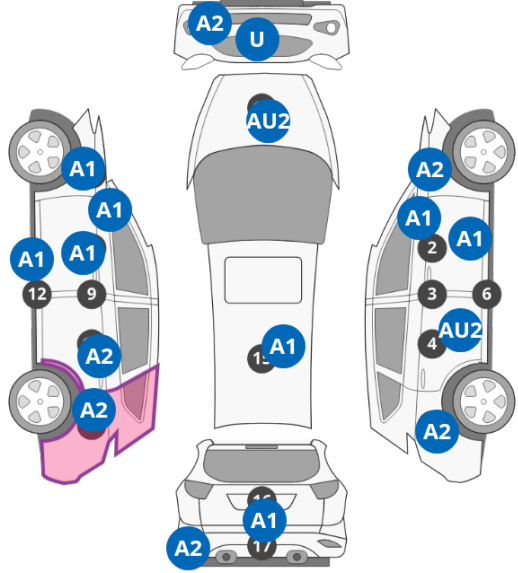
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	106	113	103
2	Boot Lid	155.6	157	156	154
3	Roof	104.0	75	77	165/100
4	Left Front Fender	165.0	167	172	156
5	Left Front Door	150.0	154	142	154
6	Center Panel Left				
7	Left Rear Door	150.3	149	143	159
8	Left Back Panel	198.0	210	184	200
9	Right Front Fender	88.6	92	94	80
10	Right Front Door	95.2	99	97	89
11	Center Panel Right				
12	Right Rear Door	101.0	101	101	101
13	Right Back Panel	105.3	112	100	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>		<p>Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes

With LTO plate and Spare tire and Warranty booklet, No Tools and Jack, No Spare key, Scratch headlight and tail light, Worn Tires, foul smell, Abnormal noise on door when it open.