

General Information

Date & Time: 05, Nov, 2025 08:55

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	9,721
Registration No.	NFF6477	Chassis No.	PA1B18F33P4234730
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



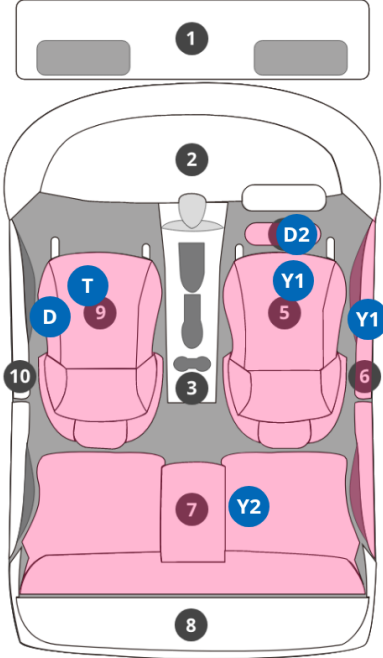
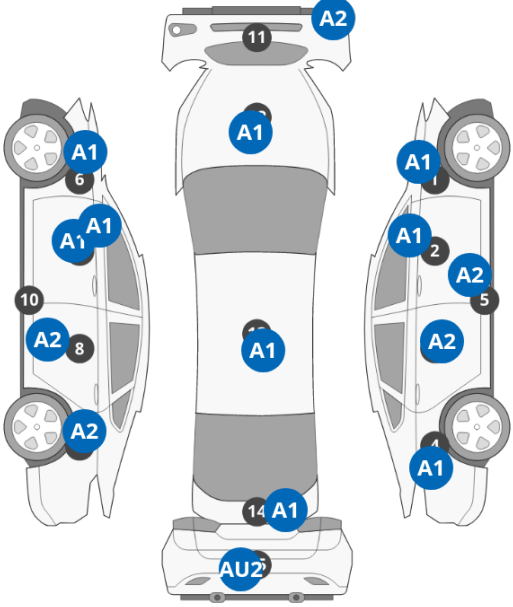
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	114	112	107
2	Boot Lid	100.6	94	102	106
3	Roof	106.8	106	119	98/105
4	Left Front Fender	107.6	124	100	99
5	Left Front Door	93.0	84	96	99
6	Center Panel Left				
7	Left Rear Door	103.6	104	108	99
8	Left Back Panel	123.6	127	145	99
9	Right Front Fender	106.3	108	107	104
10	Right Front Door	107.2	115	108	99
11	Center Panel Right				
12	Right Rear Door	109.6	110	106	113
13	Right Back Panel	111.0	108	109	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cigarette Burns - Burnt, Hole / Rear Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, no LTO plate, scratches on tail light</p>