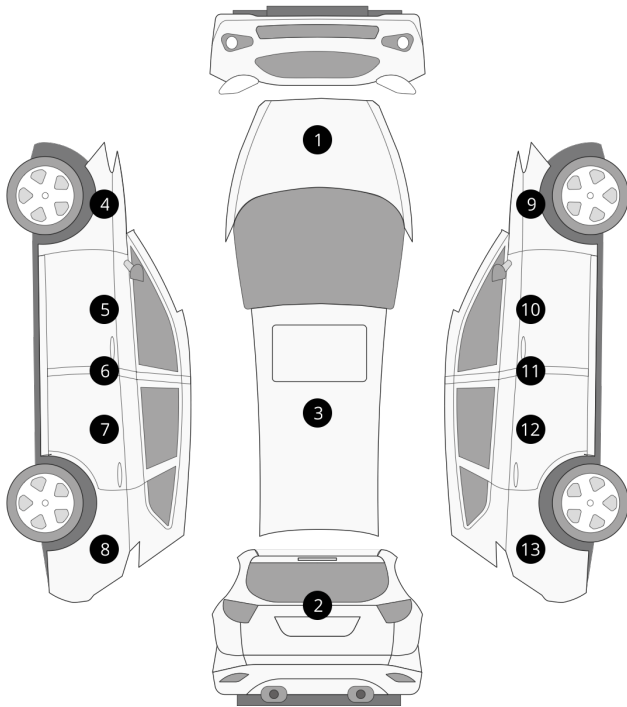


General Information

Date & Time: 13, Oct, 2025 13:18

Make	Geely	Model	Okavango
YOM	2022	Odo Meter Reading	32,058
Registration No.	NIH1899	Chassis No.	L6T7922Z8NY022625
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



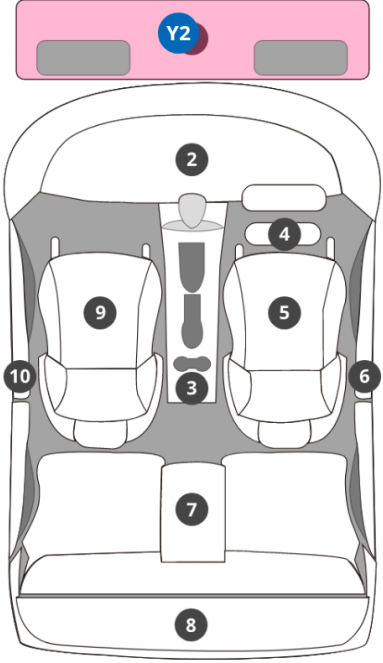
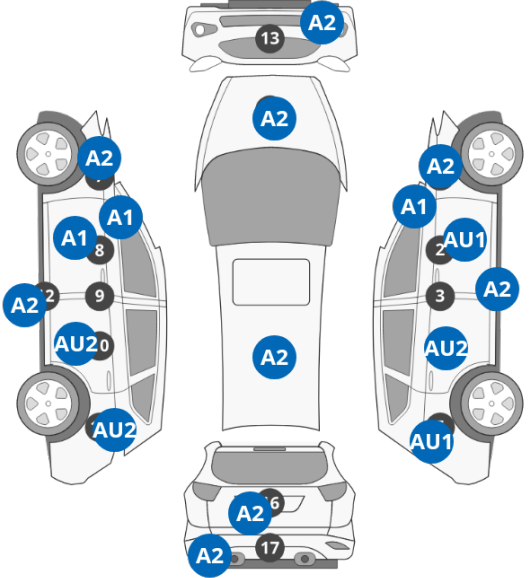
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.9	106	109	97
2	Boot Lid	86.8	91	82	88
3	Roof	120.7	113	119	129/122
4	Left Front Fender	111.6	109	109	117
5	Left Front Door	123.3	114	130	126
6	Center Panel Left				
7	Left Rear Door	122.0	123	122	121
8	Left Back Panel	112.0	113	118	105
9	Right Front Fender	107.3	102	107	113
10	Right Front Door	118.0	114	126	114
11	Center Panel Right				
12	Right Rear Door	122.6	126	119	123
13	Right Back Panel	114.6	100	111	133

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Small</p>		<p>Remarks (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
with LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and scratch headlight and tail light, no spare key. foul smel.l