

General Information

Date & Time: 13, Oct, 2025 18:18

Make	Mitsubishi	Model	Adventure
YOM	2017	Odo Meter Reading	185,356
Registration No.	NAU7040	Chassis No.	PAEVB5NMHH008769
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



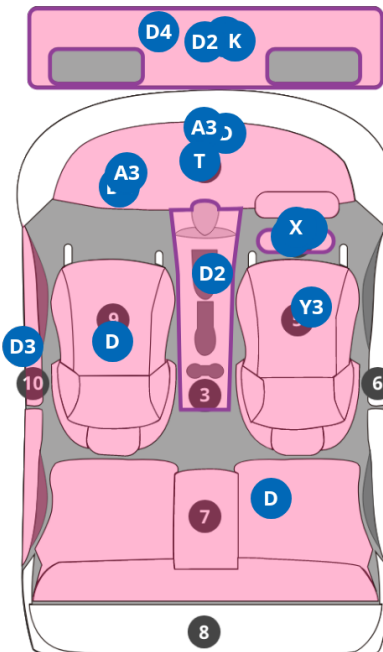
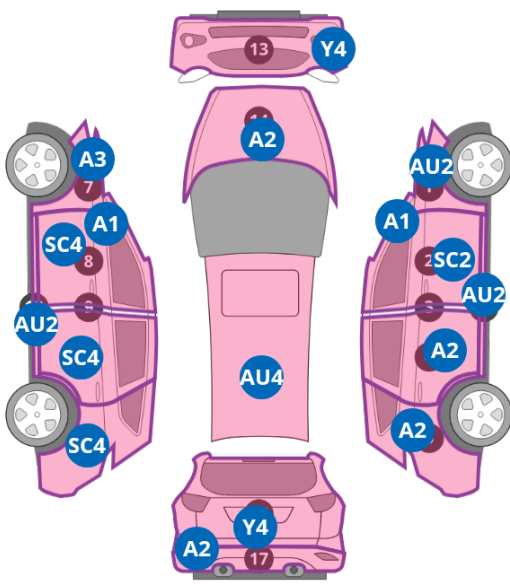
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	209.6	201	216	212
2	Boot Lid	170.0	160	159	191
3	Roof	387.7	644	490	203/214
4	Left Front Fender	258.6	258	262	256
5	Left Front Door	261.0	229	306	248
6	Center Panel Left				
7	Left Rear Door	452.3	220	178	959
8	Left Back Panel	852.0	411	881	1,264
9	Right Front Fender	191.3	172	185	217
10	Right Front Door	160.0	160	159	161
11	Center Panel Right				
12	Right Rear Door	178.0	163	159	212
13	Right Back Panel	211.6	230	182	223

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p>Interior Evaluation : E</p>	<p>Exterior Evaluation : E</p>
<div style="text-align: center;">  </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks</p> <p>(L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Sunvisor, Sunglass Holder - Loose, Deformed - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Medium / Dashboard - Cigarette Burns - Burnt / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Console, Switchs, Vents - Loose, Deformed - Small / Glove Box - Loose, Deformed - Small / Glove Box - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Trim - Loose, Deformed - Medium / Display, Audio System - Missing - Yes / Rear Seat - Worn - Yes / Ceiling - Loose, Deformed - Large / Switchs - Missing - Yes / Room Mirror - Missing - Yes / Room Lamp - Missing - Yes</p>	<p>Remarks</p> <p>(R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Re-Paint Uneven - Yes / (L) Rear Fender, Molding - Rust, Corrosion - Large / (L) Rear Door, Molding - Rust, Corrosion - Large / (L) Front Door, Molding - Rust, Corrosion - Large / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Rust, Corrosion - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch - Small</p>
<p>Frame Evaluation : D</p>	<p>Functional Evaluation : E</p>
<p>Remarks</p> <p>Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks</p> <p>Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate, No warranty booklet and Spare tire and Jack and Tools, No spare key, worn tires, adhesive marks, scratch headlight and tail light, foul smell, possible flooded, rear door left and right won't open, plate light issue, Room light issue, head unit missing, rear Aircon ventilation missing, head light issue, unusual sound when windows down and when door open, weak air-conditioned, door lock issue.