

General Information

Date & Time: 20, Oct, 2025 13:36

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	32,558
Registration No.	NHR2569	Chassis No.	PA1B18F30P4224172
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



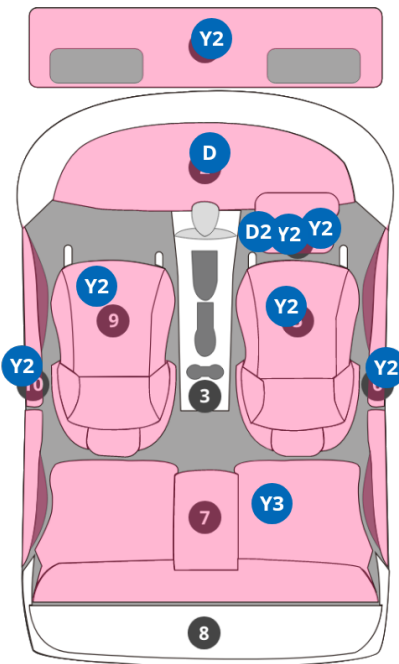
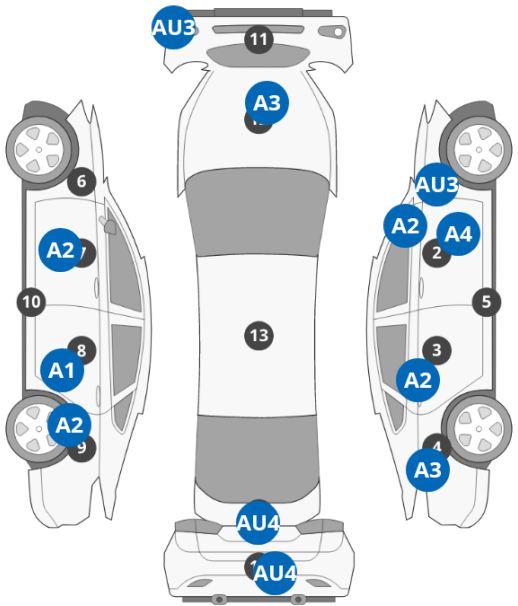
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	107	105	103
2	Boot Lid	109.0	105	113	109
3	Roof	99.7	102	99	101/97
4	Left Front Fender	97.4	98	95	99
5	Left Front Door	100.3	104	98	99
6	Center Panel Left				
7	Left Rear Door	101.4	106	96	102
8	Left Back Panel	108.6	117	109	100
9	Right Front Fender	104.6	108	103	103
10	Right Front Door	106.0	103	112	103
11	Center Panel Right				
12	Right Rear Door	105.6	105	107	105
13	Right Back Panel	106.6	100	96	124

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium</p>
Frame Evaluation : D	Functional Evaluation : E
<p>Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>	<p>Remarks Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

Inspector Notes
Damaged rear bumper and trunk door. Crack/gap at right taillight. With warranty booklet, spare tire and jack. Without tools and seat cover. 1 key. Temporary plate.