

General Information

Date & Time: 05, Nov, 2025 17:42

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	27,389
Registration No.	NIC1778	Chassis No.	MHKA4DF5FNJ070642
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



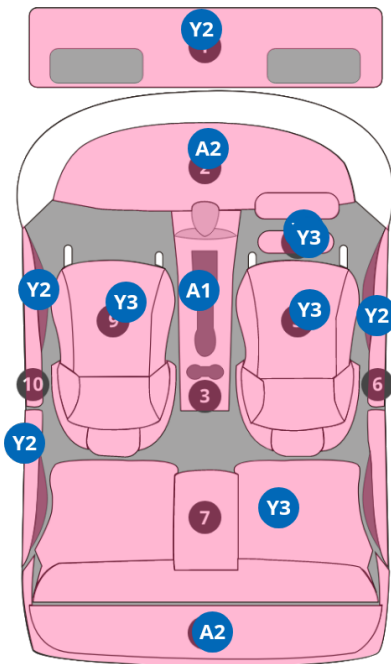
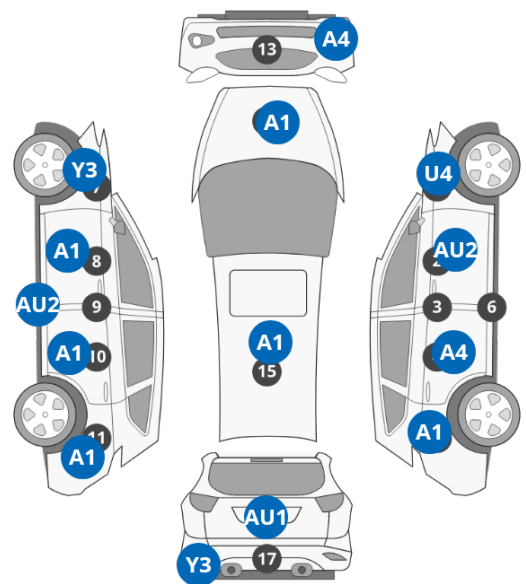
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.1	99	103	93
2	Boot Lid	101.9	96	110	100
3	Roof	93.1	73	95	106/99
4	Left Front Fender	110.4	93	114	124
5	Left Front Door	114.0	116	113	113
6	Center Panel Left				
7	Left Rear Door	106.3	99	116	104
8	Left Back Panel	105.4	95	114	107
9	Right Front Fender	115.1	123	124	98
10	Right Front Door	103.0	96	106	107
11	Center Panel Right				
12	Right Rear Door	100.6	110	99	93
13	Right Back Panel	112.0	117	107	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Dent - Large / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack No tools/with reverse camera/No warranty booklet/No vs form/forced repo/towed unit/No spare key</p>