

General Information

Date & Time: 18, Oct, 2025 15:21

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	11,407
Registration No.	VAC1748	Chassis No.	MHKB3FE10PK003318
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Cargo
Colour	White		

Body / Panel Condition



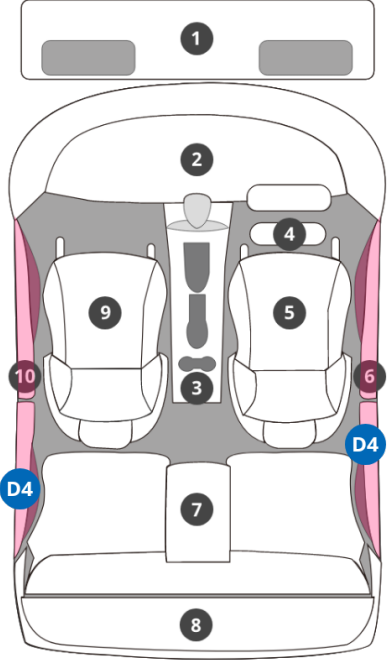
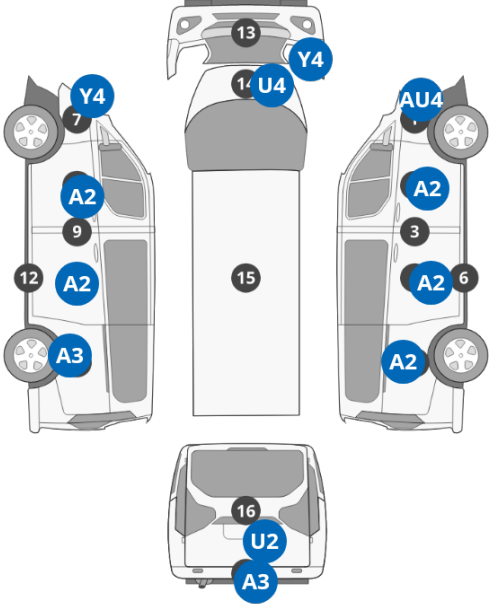
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	51.6	53	54	48
2	Boot Lid	56.0	53	68	46
3	Roof	64.7	60	55	66/78
4	Left Front Fender	54.4	51	53	60
5	Left Front Door	53.0	59	48	52
6	Center Panel Left				
7	Left Rear Door	54.0	56	50	56
8	Left Back Panel	50.7	45	53	55
9	Right Front Fender	53.7	53	49	59
10	Right Front Door	49.7	47	49	53
11	Center Panel Right				
12	Right Rear Door	59.2	63	55	60
13	Right Back Panel	55.5	50	54	63

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Rear Trim - Worked - Large / (R) Rear Trim - Worked - Large	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Crack, Gap - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small
Frame Evaluation : C	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with jack and spare tire/ no tools and no LTO plate/