

General Information

Date & Time: 15, Oct, 2025 12:42

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	52,385
Registration No.	DBM8428	Chassis No.	PA1B18F30R4246045
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



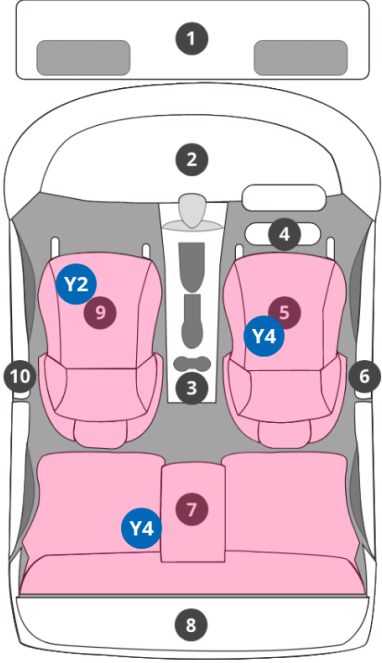
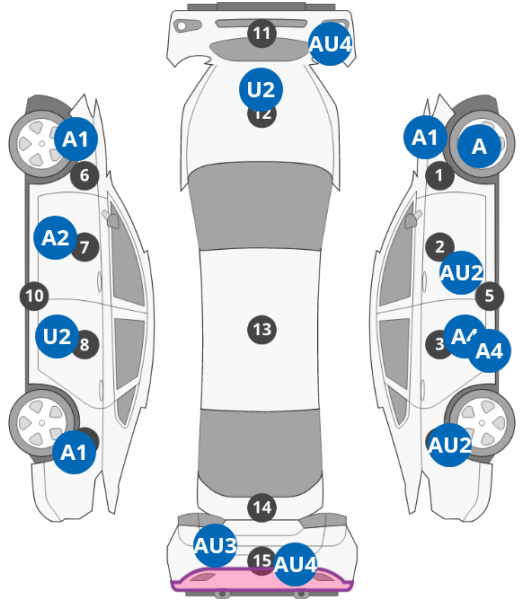
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	128	115	128
2	Boot Lid	114.3	115	111	117
3	Roof	113.0	112	122	101/117
4	Left Front Fender	104.3	105	100	108
5	Left Front Door	110.0	109	109	112
6	Center Panel Left				
7	Left Rear Door	112.3	116	110	111
8	Left Back Panel	115.6	115	115	117
9	Right Front Fender	108.0	103	109	112
10	Right Front Door	108.3	109	111	105
11	Center Panel Right				
12	Right Rear Door	119.6	119	123	117
13	Right Back Panel	113.3	103	107	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Large	Remarks (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Tyre - Crack, Cut - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with spare tire and jack/ with LTO plate and tools/ front right tire issue