

General Information

Date & Time: 15, Oct, 2025 08:38

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	10,796
Registration No.	DBO1933	Chassis No.	PA1B18F30P4232479
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



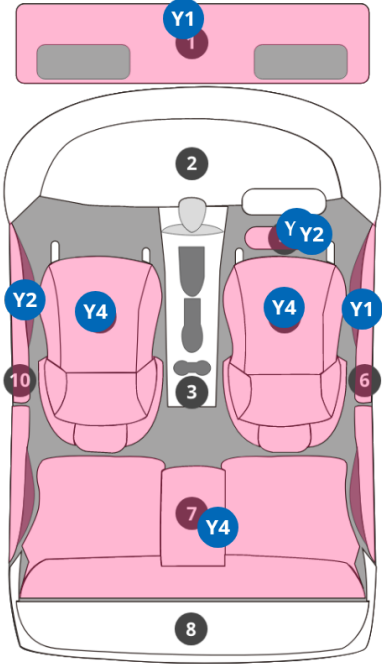
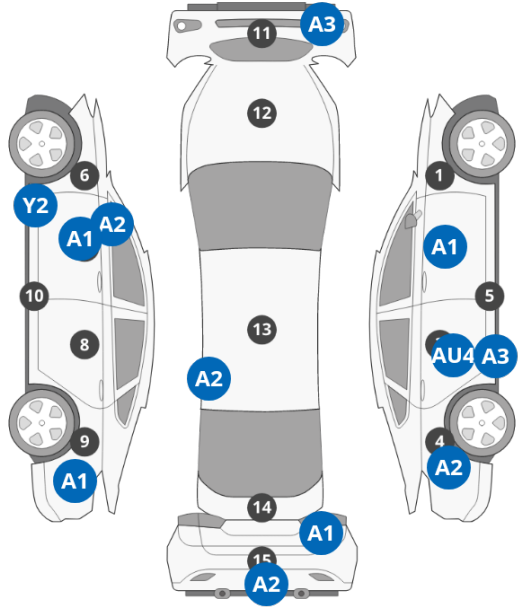
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	115	119	110
2	Boot Lid	110.0	103	115	112
3	Roof	102.6	106	94	102/109
4	Left Front Fender	103.6	103	103	105
5	Left Front Door	102.9	105	100	104
6	Center Panel Left				
7	Left Rear Door	102.8	106	100	103
8	Left Back Panel	112.3	118	113	106
9	Right Front Fender	105.3	110	104	102
10	Right Front Door	103.8	111	100	101
11	Center Panel Right				
12	Right Rear Door	101.6	94	103	108
13	Right Back Panel	105.7	97	108	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate/with spare tire/with jack and incomplete tools/No reverse camera/No warranty booklet/No spare key