

General Information

Date & Time: 15, Oct, 2025 13:57

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	6,526
Registration No.	EAJ2644	Chassis No.	MHKAA1BC5RJ018859
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



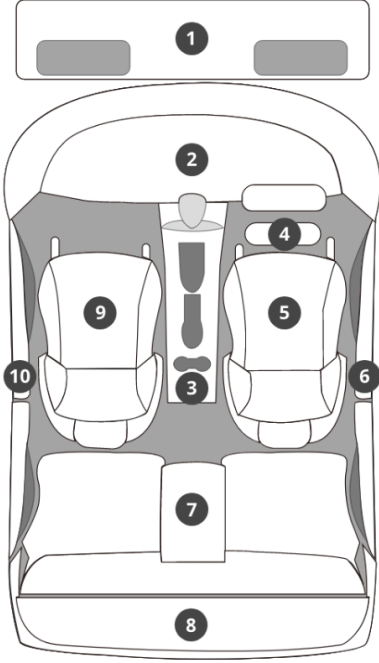
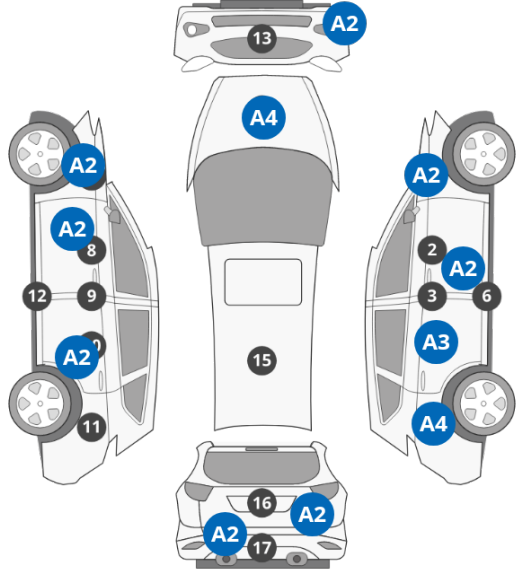
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	116	122	117
2	Boot Lid	82.1	78	92	77
3	Roof	79.3	83	76	87/72
4	Left Front Fender	94.0	83	106	93
5	Left Front Door	112.0	107	113	116
6	Center Panel Left				
7	Left Rear Door	103.4	112	101	97
8	Left Back Panel	97.5	100	96	97
9	Right Front Fender	89.5	96	90	83
10	Right Front Door	108.0	110	110	104
11	Center Panel Right				
12	Right Rear Door	101.2	95	99	109
13	Right Back Panel	91.6	91	86	98

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Bonnet, Headlight - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with jack and spare tire/ with tools and LTO plate/ no warranty booklet/ paint marks all over the vehicle