

General Information

Date & Time: 16, Dec, 2024 15:17

Make	Toyota	Model	Vios
YOM	2021	Mileage	69,462
Registration No.	NEX4823	Chassis No.	PA1B18F3XM4142512
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



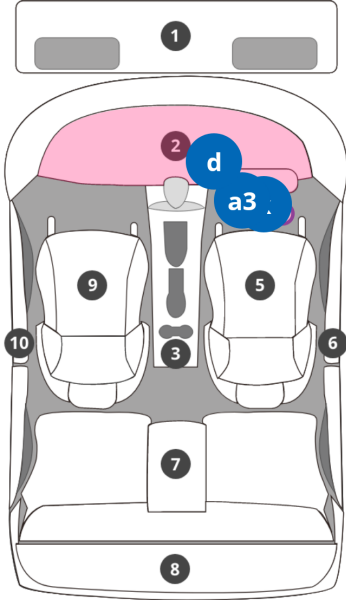
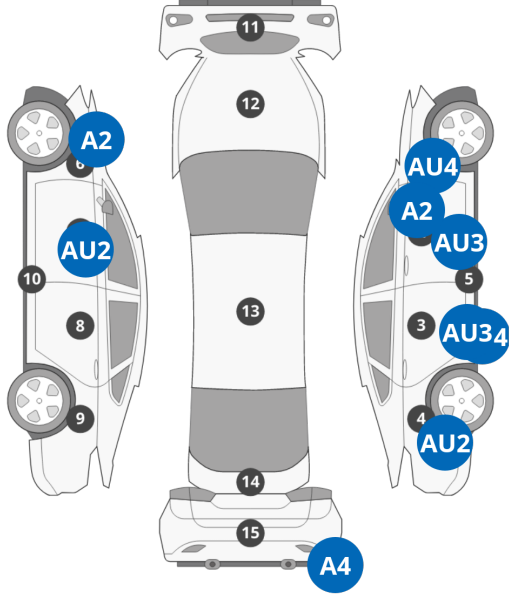
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.6	102	96	101
2	Boot Lid	100.5	100	94	108
3	Roof	91.2	96	90	92/87
4	Left Front Fender	84.8	91	86	77
5	Left Front Door	91.5	88	96	90
6	Center Panel Left				
7	Left Rear Door	87.5	91	90	81
8	Left Back Panel	97.4	102	98	92
9	Right Front Fender	87.3	81	90	90
10	Right Front Door	86.4	84	88	88
11	Center Panel Right				
12	Right Rear Door	93.8	89	93	100
13	Right Back Panel	92.7	93	91	94

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no spare tire/no tools/ no warranty booklet/ with jack