

General Information

Date & Time: 15, Oct, 2025 10:18

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	109,385
Registration No.	NHI6553	Chassis No.	MHFAA1BY1P0013171
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



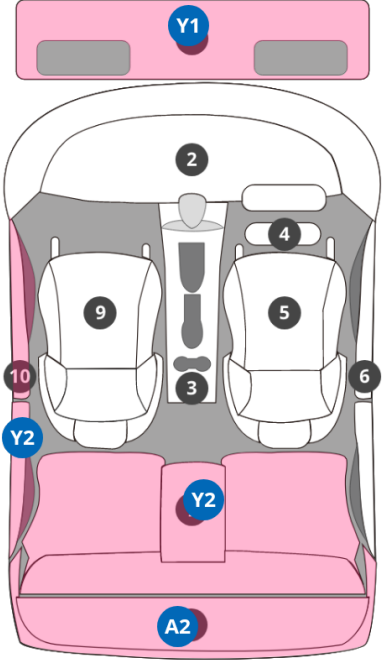
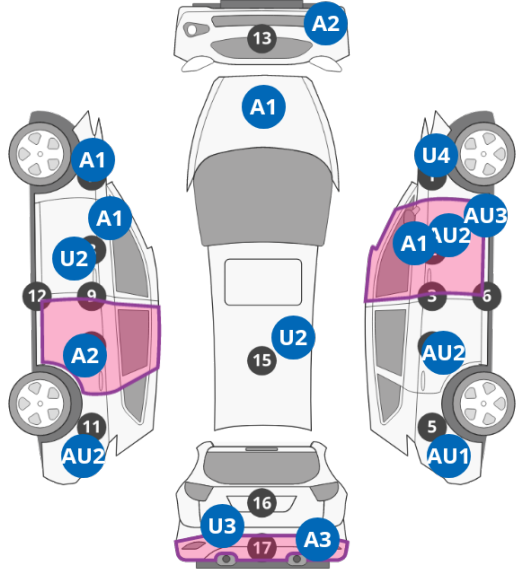
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	113	100	105
2	Boot Lid	106.0	107	122	89
3	Roof	106.7	110	108	104/105
4	Left Front Fender	112.6	110	112	116
5	Left Front Door	115.0	112	111	122
6	Center Panel Left				
7	Left Rear Door	111.3	116	105	113
8	Left Back Panel	110.3	113	111	107
9	Right Front Fender	105.0	104	111	100
10	Right Front Door	110.0	115	107	108
11	Center Panel Right				
12	Right Rear Door	116.6	124	109	117
13	Right Back Panel	105.6	105	100	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / Ceiling - Grime - Minimal	Remarks Roof - Dent - Small / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Fender, Molding - Dent - Large / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Dent - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/with jack No tools/with reverse camera/No spare key/with warranty booklet