

General Information

Date & Time: 15, Oct, 2025 16:34

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	7,098
Registration No.	NHQ3620	Chassis No.	MHFAA1BY8P0022384
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



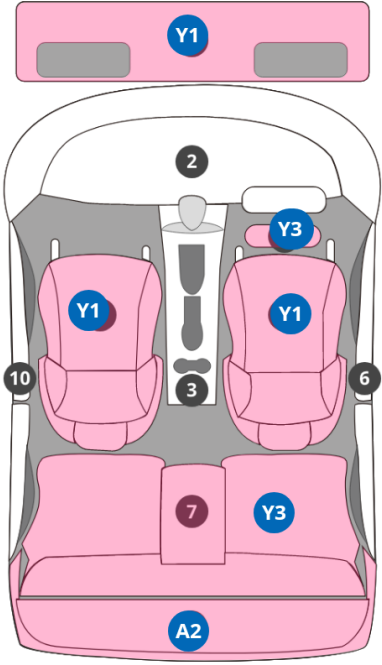
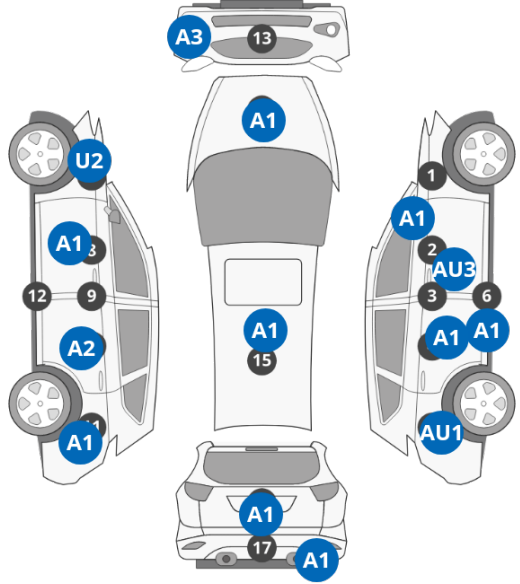
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	108	110	114
2	Boot Lid	96.8	90	105	95
3	Roof	119.5	123	124	106/125
4	Left Front Fender	101.3	102	97	105
5	Left Front Door	117.0	110	119	122
6	Center Panel Left				
7	Left Rear Door	112.6	113	110	115
8	Left Back Panel	113.8	124	122	96
9	Right Front Fender	105.0	103	105	107
10	Right Front Door	112.3	118	109	110
11	Center Panel Right				
12	Right Rear Door	108.0	108	105	111
13	Right Back Panel	103.7	95	104	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Mat Other - Grime - Medium / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

No LTO plate/with spare tire/with spare key/with reverse camera/with warranty booklet with jack /No tools