

General Information

Date & Time: 23, Oct, 2025 10:54

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	36,070
Registration No.	NGB2598	Chassis No.	PA1B18F34L4120567
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



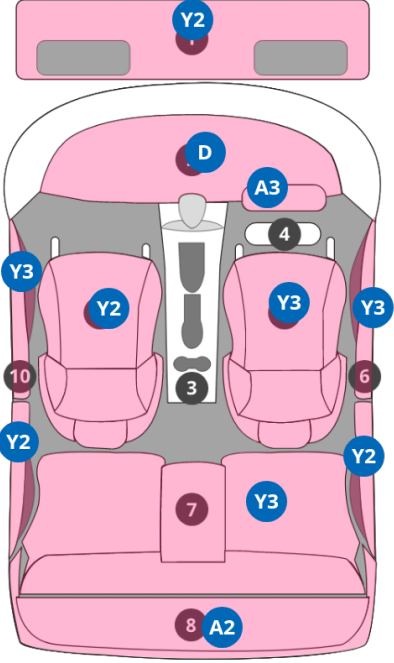
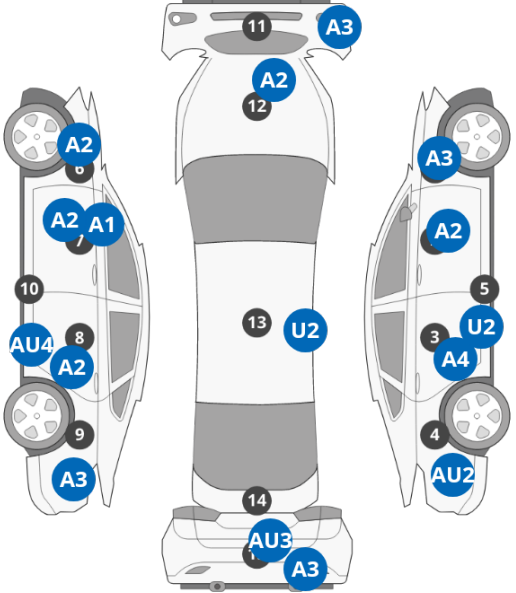
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	91	111	103
2	Boot Lid	107.0	107	105	109
3	Roof	94.9	105	92	88/95
4	Left Front Fender	96.7	94	97	99
5	Left Front Door	101.8	102	98	105
6	Center Panel Left				
7	Left Rear Door	100.2	98	101	102
8	Left Back Panel	105.6	113	103	101
9	Right Front Fender	92.4	95	94	89
10	Right Front Door	145.0	144	159	132
11	Center Panel Right				
12	Right Rear Door	97.3	95	91	106
13	Right Back Panel	100.5	94	100	108

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack No tools/reverse camera not working/No spare key/with warranty booklet</p>