

## General Information

Date & Time: 13, Oct, 2025 18:19

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	10,495
<b>Registration No.</b>	CCJ3920	<b>Chassis No.</b>	PA1B18F30R4275285
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



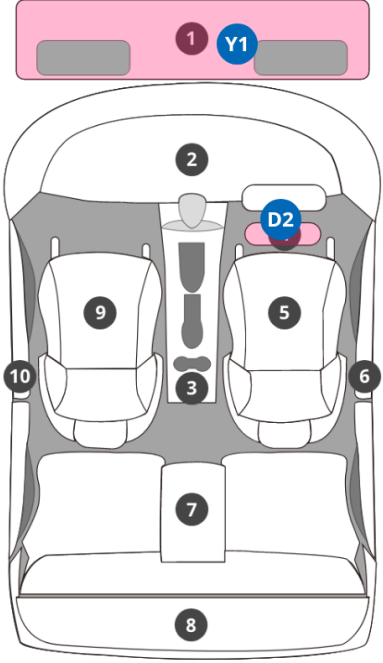
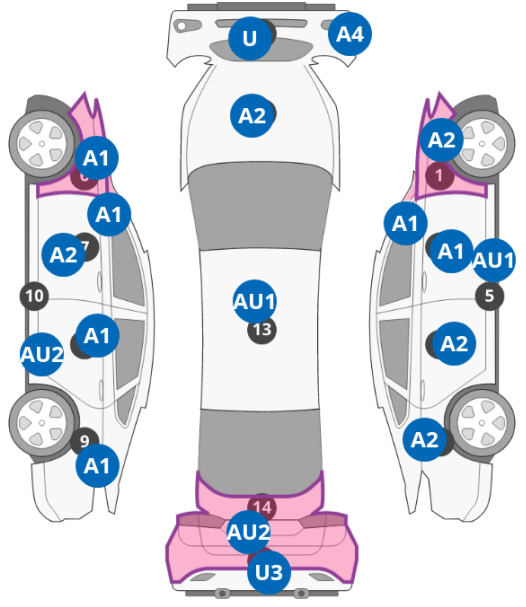
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>124.0</b>	115	104	153
2	Boot Lid	<b>102.9</b>	100	105	104
3	Roof	<b>101.7</b>	100	101	101/105
4	Left Front Fender	<b>97.4</b>	99	96	97
5	Left Front Door	<b>103.7</b>	102	99	110
6	Center Panel Left				
7	Left Rear Door	<b>108.2</b>	122	105	98
8	Left Back Panel	<b>113.3</b>	117	114	109
9	Right Front Fender	<b>104.2</b>	99	105	109
10	Right Front Door	<b>101.0</b>	104	98	101
11	Center Panel Right				
12	Right Rear Door	<b>102.7</b>	97	98	113
13	Right Back Panel	<b>110.3</b>	114	105	112

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<b>Remarks</b> Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With LTO plate and Jack and Incomplete Tools, No warranty booklet and Sparetire, No spare key, Abnormal vibration on engine, plate light issue, Room light issue, foul smell, worn tires, crack headlight and tail light.