

General Information

Date & Time: 15, Oct, 2025 17:31

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	14,893
Registration No.	NHJ7106	Chassis No.	PA1B18F36P4221339
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



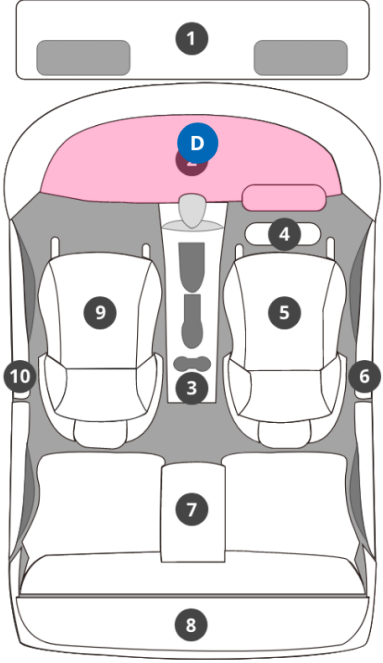
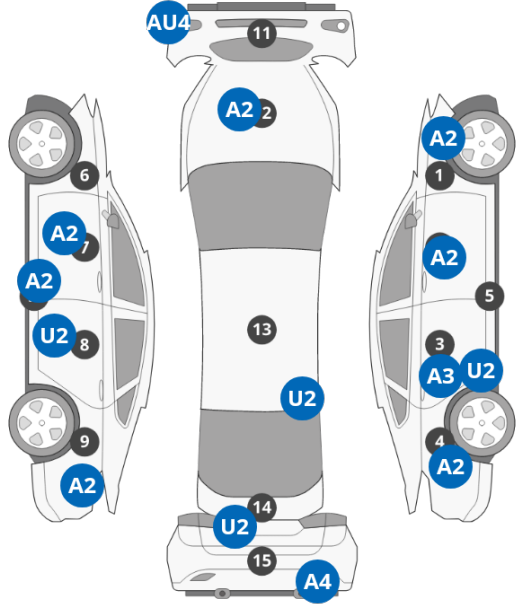
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	125	120	130
2	Boot Lid	130.6	129	133	130
3	Roof	110.0	121	102	109/108
4	Left Front Fender	111.6	113	112	110
5	Left Front Door	109.0	113	107	107
6	Center Panel Left				
7	Left Rear Door	106.6	111	104	105
8	Left Back Panel	116.3	122	109	118
9	Right Front Fender	118.0	125	116	113
10	Right Front Door	119.6	118	117	124
11	Center Panel Right				
12	Right Rear Door	159.6	189	144	146
13	Right Back Panel	372.0	151	613	352

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Dent - Small / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet and LTO plate/ with spare tire and jack/ incomplete tools