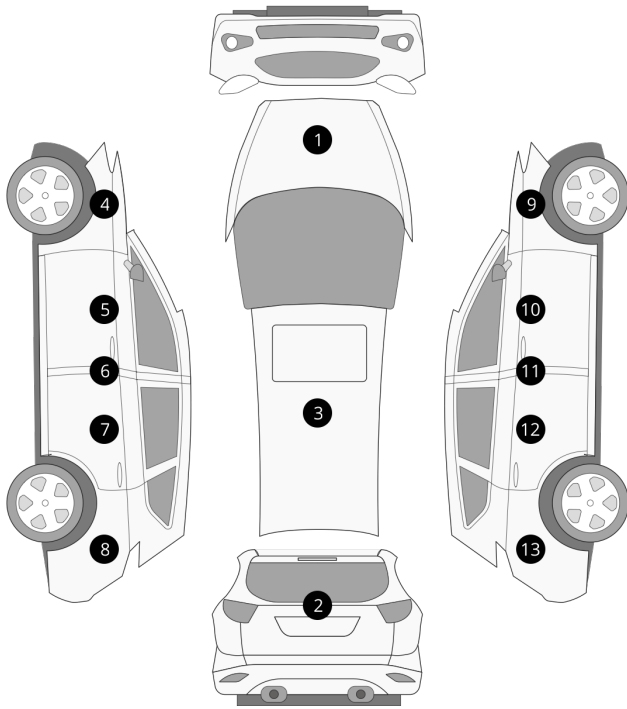


General Information

Date & Time: 20, Oct, 2025 12:57

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	14,067
Registration No.	DBF9223	Chassis No.	PAEA13TJRRRA029065
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



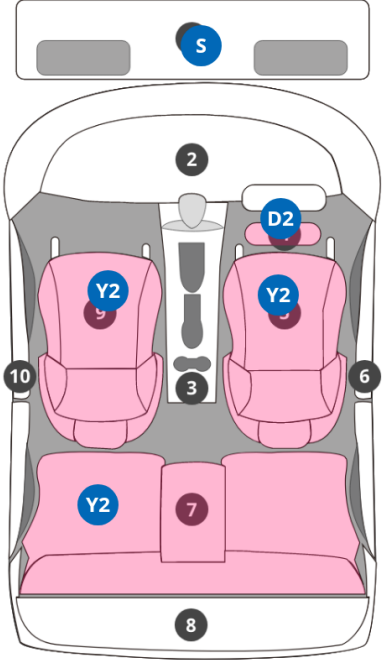
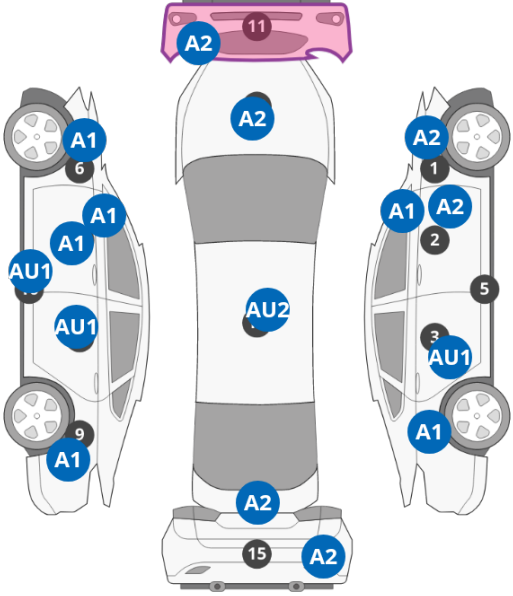
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	116	120	120
2	Boot Lid	101.7	99	108	99
3	Roof	94.4	90	94	100/95
4	Left Front Fender	96.2	104	94	91
5	Left Front Door	99.4	98	101	100
6	Center Panel Left				
7	Left Rear Door	99.5	102	98	98
8	Left Back Panel	155.0	155	178	132
9	Right Front Fender	98.8	95	100	102
10	Right Front Door	106.3	107	104	108
11	Center Panel Right				
12	Right Rear Door	99.6	96	96	107
13	Right Back Panel	102.6	102	102	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Spare tire and Jack and Incomplete Tools, No warranty booklet, scratch headlight and tail light, no spare key, worn tires, foul smell, No reverse camera, adhesive marks on vehicle, busted Plate light.