

General Information

Date & Time: 20, Oct, 2025 12:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	9,671
Registration No.	CAZ8438	Chassis No.	PA1B18F32P4238414
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



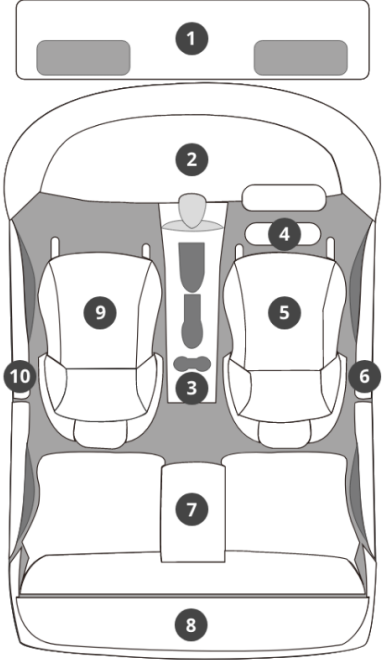
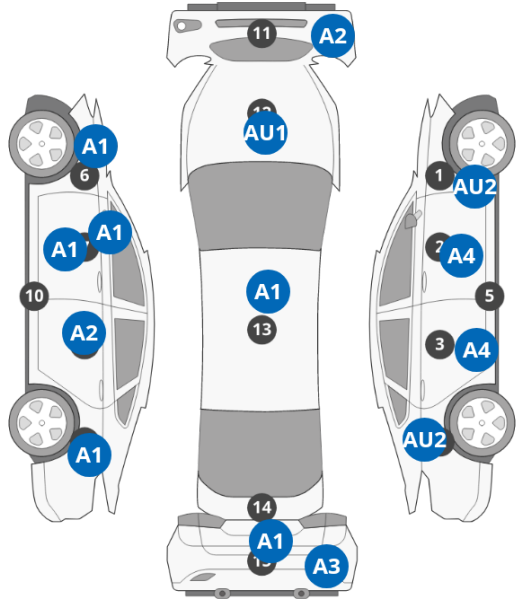
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	119	112	122
2	Boot Lid	123.0	122	116	131
3	Roof	96.4	99	98	90/99
4	Left Front Fender	108.0	114	108	102
5	Left Front Door	102.3	105	100	102
6	Center Panel Left				
7	Left Rear Door	100.5	102	102	98
8	Left Back Panel	106.0	108	106	104
9	Right Front Fender	114.6	111	117	116
10	Right Front Door	114.3	113	109	121
11	Center Panel Right				
12	Right Rear Door	112.6	108	110	120
13	Right Back Panel	112.0	115	109	112

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, No spare key, no reverse camera, scratch headlight and tail light.