

General Information

Date & Time: 17, Nov, 2025 18:58

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	29,246
Registration No.	FAR1885	Chassis No.	PA2JA8EM5P0134900
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



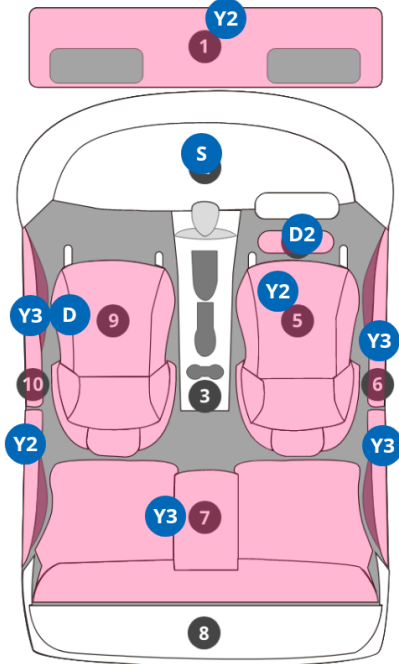
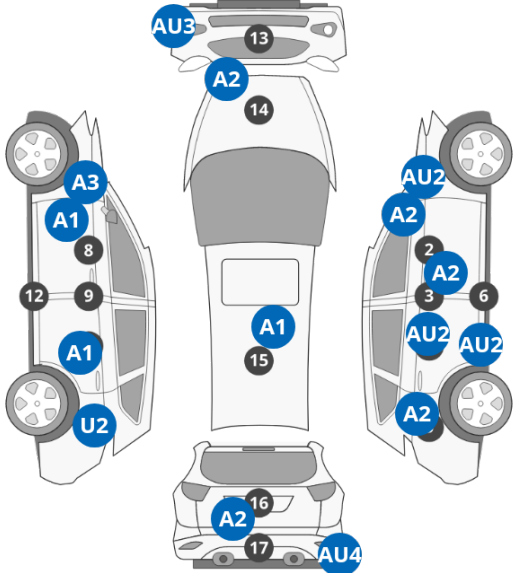
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	101	115	93
2	Boot Lid	107.0	108	112	101
3	Roof	97.0	97	103	89/100
4	Left Front Fender	99.8	97	104	99
5	Left Front Door	104.8	118	100	97
6	Center Panel Left				
7	Left Rear Door	102.6	104	102	102
8	Left Back Panel	103.6	100	110	101
9	Right Front Fender	102.4	108	103	96
10	Right Front Door	106.3	107	108	104
11	Center Panel Right				
12	Right Rear Door	104.3	99	103	111
13	Right Back Panel	107.0	110	105	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, no spare tire, no LTO plate, possible flooding, scratches on tail light, shift shock issue, abnormal noise when shifting, warning lamp and traction control indicator ON, weak battery, grime on trunk room,</p>