

General Information

Date & Time: 12, Nov, 2025 17:29

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	53,720
Registration No.	NFC9365	Chassis No.	MHFA1BYXP0016800
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



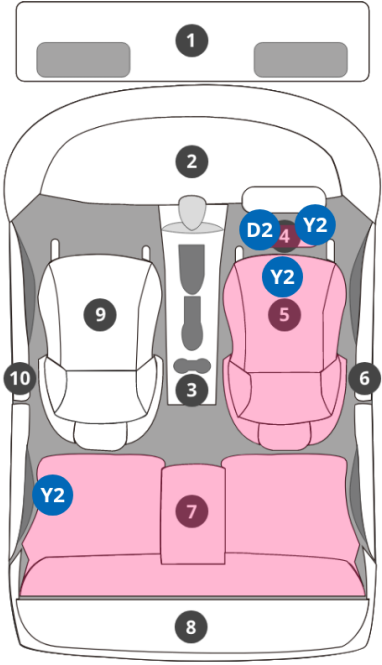
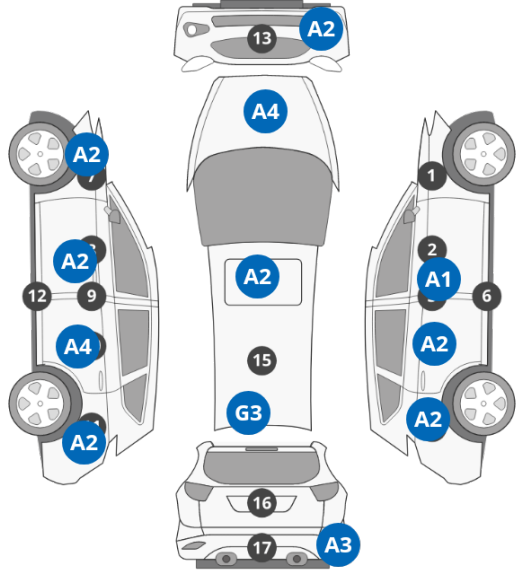
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	241.0	383	192	148
2	Boot Lid	103.2	101	116	93
3	Roof	102.0	109	103	97/100
4	Left Front Fender	111.3	108	106	120
5	Left Front Door	106.0	102	103	113
6	Center Panel Left				
7	Left Rear Door	102.8	107	105	96
8	Left Back Panel	107.1	122	103	96
9	Right Front Fender	164.3	161	163	169
10	Right Front Door	163.0	153	184	152
11	Center Panel Right				
12	Right Rear Door	129.6	130	127	132
13	Right Back Panel	101.4	91	100	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Windshield - Scratch, Stone chip - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Power folding side mirror issue. Without warranty booklet, tools and seat cover. With spare tire and jack. 1 key. With LTO plate.