

General Information

Date & Time: 27, Oct, 2025 10:12

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	139,096
Registration No.	DAS5404	Chassis No.	PA1B18F30N4192658
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



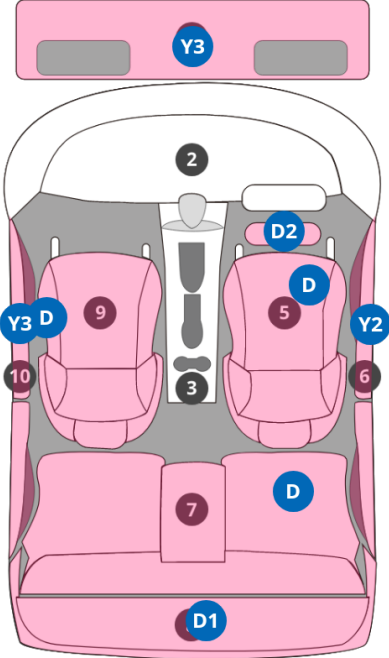
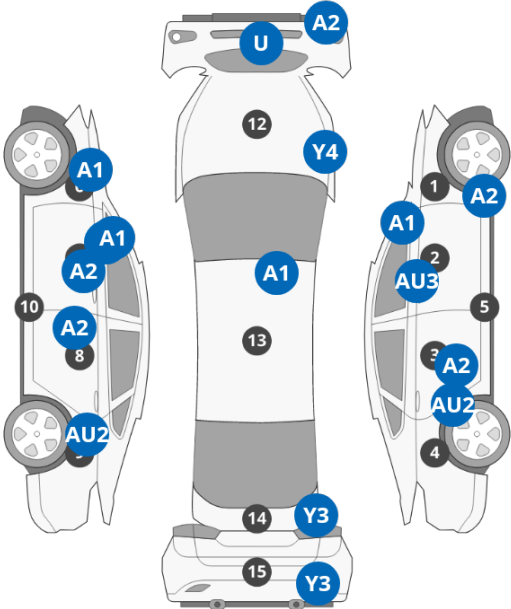
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	112	110	113
2	Boot Lid	110.6	106	104	122
3	Roof	96.1	104	91	92/98
4	Left Front Fender	99.0	108	96	93
5	Left Front Door	94.6	94	100	90
6	Center Panel Left				
7	Left Rear Door	100.3	99	100	102
8	Left Back Panel	107.9	119	106	99
9	Right Front Fender	107.6	103	119	101
10	Right Front Door	104.6	101	105	108
11	Center Panel Right				
12	Right Rear Door	108.6	114	107	105
13	Right Back Panel	101.8	97	101	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / Trunk Room - Worked - Minimal / (L) Front Trim - Grime - Medium</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Stuck - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Crack, Gap - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratched and cracked tail light, headlight and park light missing, front bumper partially missing, front signal light missing, trunk floormat/cover missing, engine abnormal noise</p>