

General Information

Date & Time: 29, Oct, 2025 13:24

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	48,891
Registration No.	DBG2943	Chassis No.	PA2JA8EM5N0112683
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



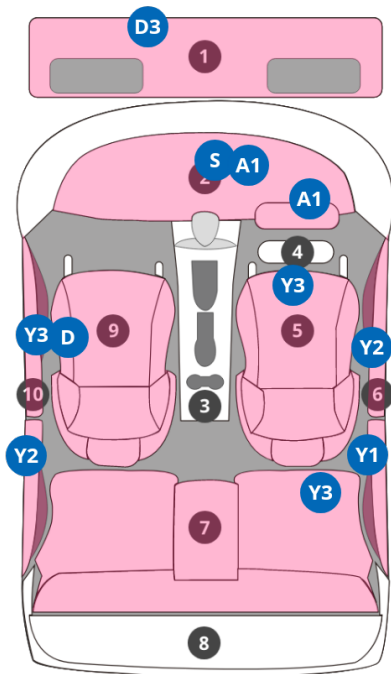
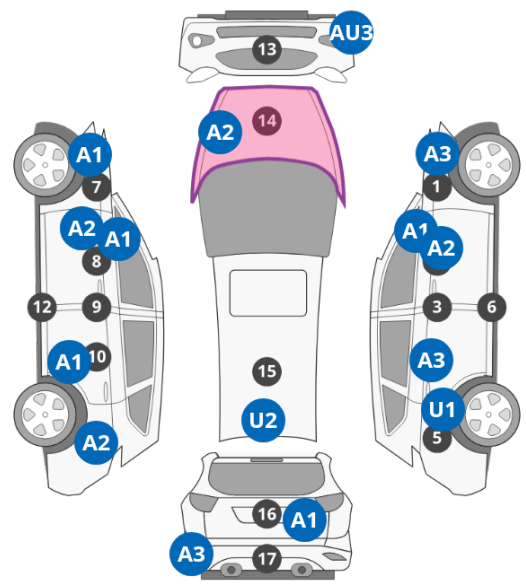
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.1	120	81	139
2	Boot Lid	100.8	105	104	94
3	Roof	95.6	104	98	92/89
4	Left Front Fender	140.6	131	128	163
5	Left Front Door	180.6	193	193	156
6	Center Panel Left				
7	Left Rear Door	138.3	134	154	127
8	Left Back Panel	115.3	122	119	105
9	Right Front Fender	141.0	136	146	141
10	Right Front Door	98.9	103	100	94
11	Center Panel Right				
12	Right Rear Door	143.0	156	144	129
13	Right Back Panel	102.1	96	103	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Crinkle - Medium</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>	
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, possible flooding, scratches on tail light, loose right side mirror cover, worn tires</p>	