

## General Information

Date & Time: 27, Oct, 2025 10:40

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	22,511
<b>Registration No.</b>	DBJ7128	<b>Chassis No.</b>	PA1B18F32P4226425
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



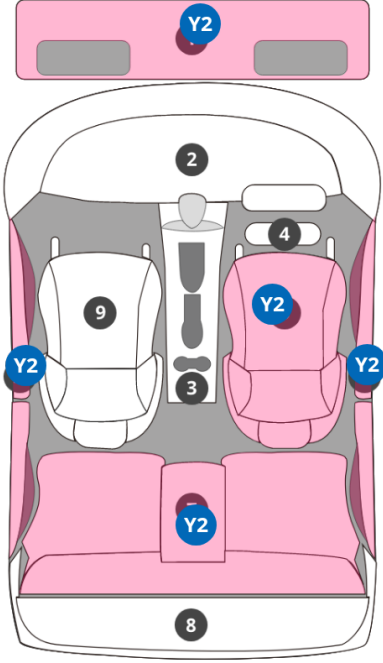
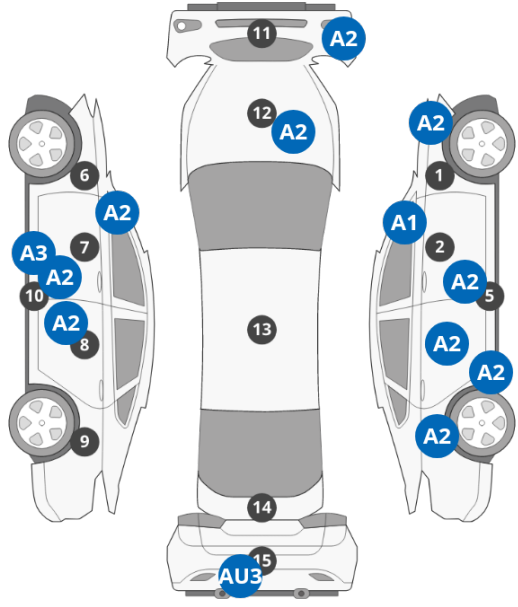
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.8	100	100	100
2	Boot Lid	96.1	92	100	97
3	Roof	92.8	97	97	85/93
4	Left Front Fender	90.5	94	88	90
5	Left Front Door	93.6	93	92	97
6	Center Panel Left				
7	Left Rear Door	96.0	101	95	92
8	Left Back Panel	105.3	112	106	98
9	Right Front Fender	98.0	100	97	97
10	Right Front Door	95.2	93	98	96
11	Center Panel Right				
12	Right Rear Door	94.0	96	90	96
13	Right Back Panel	100.6	97	98	107

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet. Incomplete tools. With spare tire and jack. 2 keys. With LTO plate.</p>