

General Information

Date & Time: 03, Nov, 2025 15:45

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	39,333
Registration No.	DBP8277	Chassis No.	MHKAA1BC8RJ021710
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



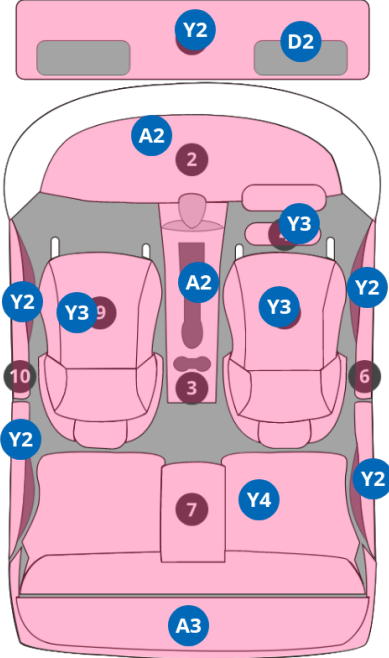
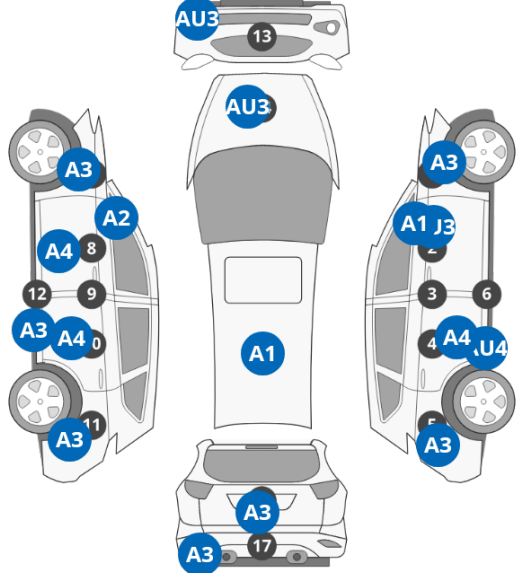
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	115	113	118
2	Boot Lid	92.2	84	96	96
3	Roof	85.8	87	86	93/77
4	Left Front Fender	100.0	96	104	100
5	Left Front Door	107.6	106	104	113
6	Center Panel Left				
7	Left Rear Door	111.3	123	106	105
8	Left Back Panel	99.9	99	101	100
9	Right Front Fender	100.6	114	96	92
10	Right Front Door	101.2	110	99	95
11	Center Panel Right				
12	Right Rear Door	96.6	95	95	100
13	Right Back Panel	93.3	88	95	97

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Sunvisor, Sunglass Holder - Loose, Deformed - Small</p>	<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Mirror - Scratch - Small / Roof - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack and tools/with warranty booklet/with reverse camera/No spare key/sunvisor issue</p>