

General Information

Date & Time: 27, Oct, 2025 15:24

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,237
Registration No.	NFR1229	Chassis No.	PA1B18F3XR4244766
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



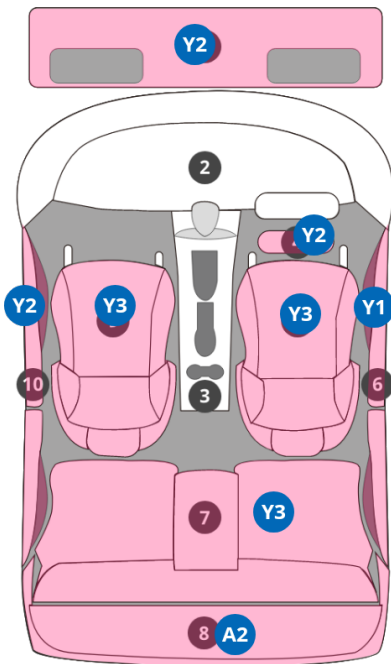
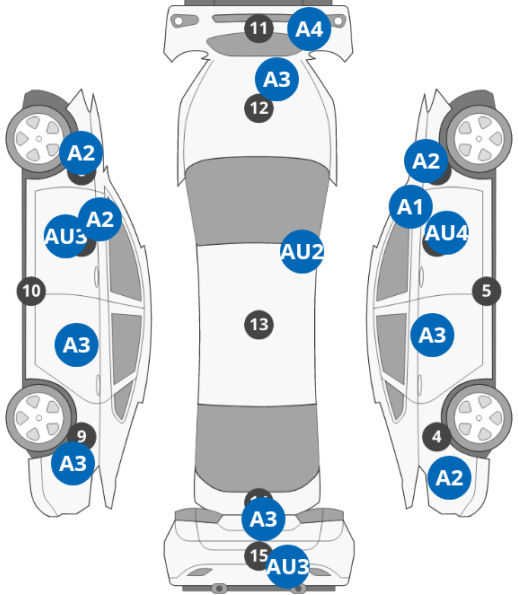
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.7	120	106	97
2	Boot Lid	101.2	99	100	105
3	Roof	98.1	100	103	93/97
4	Left Front Fender	97.8	98	99	97
5	Left Front Door	99.7	100	102	97
6	Center Panel Left				
7	Left Rear Door	103.2	109	102	99
8	Left Back Panel	105.3	114	101	101
9	Right Front Fender	101.2	106	98	100
10	Right Front Door	125.3	105	113	158
11	Center Panel Right				
12	Right Rear Door	107.3	109	110	103
13	Right Back Panel	103.0	100	109	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare tire/with reverse camera/No jack and No tools/with spare tire/with warranty booklet</p>