

## General Information

Date & Time: 30, Oct, 2025 15:59

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	29,055
<b>Registration No.</b>	NIB8987	<b>Chassis No.</b>	PA1B18F31N4180468
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



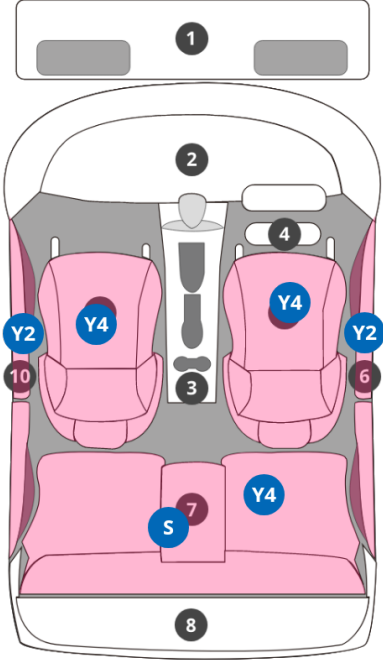
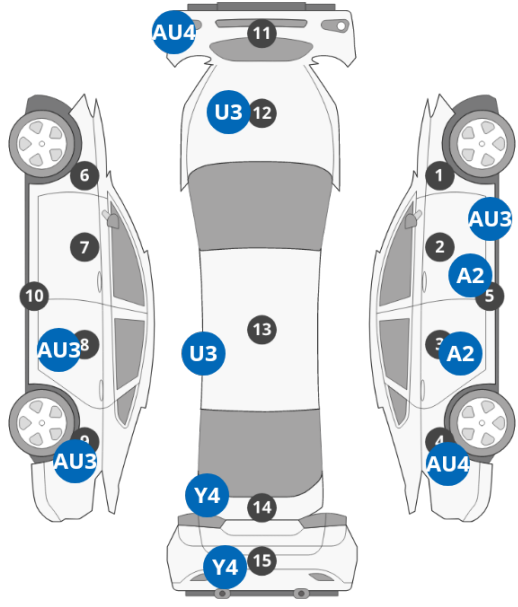
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	111	106	120
2	Boot Lid	112.6	106	117	115
3	Roof	98.9	108	92	97/99
4	Left Front Fender	109.6	116	100	113
5	Left Front Door	107.6	108	112	103
6	Center Panel Left				
7	Left Rear Door	102.3	105	102	100
8	Left Back Panel	107.3	112	107	103
9	Right Front Fender	94.5	94	93	96
10	Right Front Door	96.3	101	94	95
11	Center Panel Right				
12	Right Rear Door	99.1	96	93	109
13	Right Back Panel	105.0	100	102	113

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Large</p>	<p><b>Remarks</b> Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Roof - Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet and tools/ possible flooding/no spare tire/ with jack and LTO plate</p>