

General Information

Date & Time: 30, Oct, 2025 11:16

Make	Toyota	Model	Vios
YOM	2011	Odo Meter Reading	117,241
Registration No.	TBI669	Chassis No.	NCP929042625
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



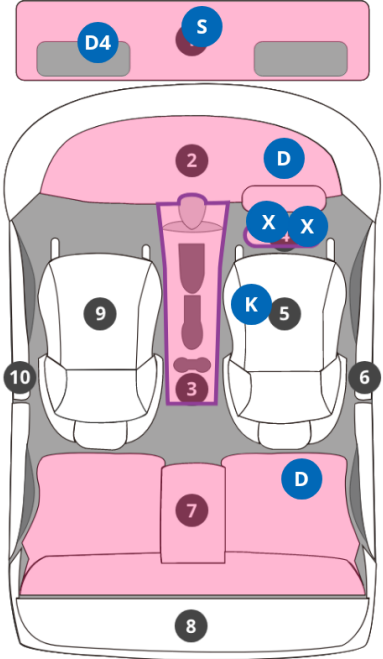
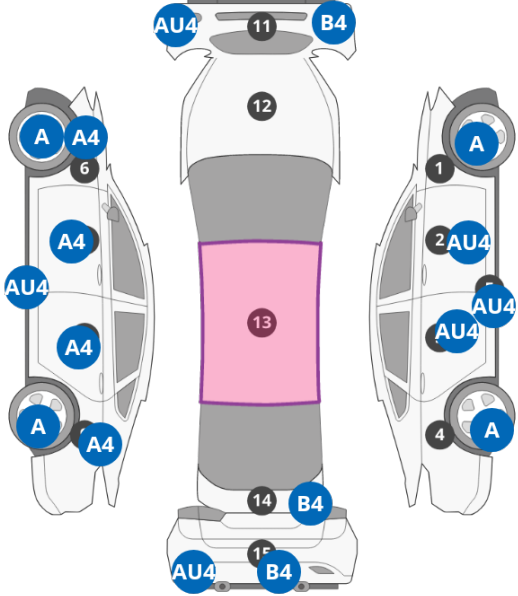
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.0	173	134	143
2	Boot Lid	236.0	237	237	234
3	Roof	88.9	84	86	105/80
4	Left Front Fender	168.6	172	181	153
5	Left Front Door	129.3	114	135	139
6	Center Panel Left				
7	Left Rear Door	136.3	136	128	145
8	Left Back Panel	160.0	163	154	163
9	Right Front Fender	163.3	162	169	159
10	Right Front Door	134.0	136	122	144
11	Center Panel Right				
12	Right Rear Door	482.3	847	406	194
13	Right Back Panel	349.6	165	167	717

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Overall Interior - Animal Hair - Yes / Rear Seat - Worn - Yes / Display, Audio System - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Sunvisor, Sunglass Holder - Worked - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Modified - Large / Trunk Hood, Rear Gate - Modified - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Modified - Large / (R) Front Tyre - Crack, Cut - Yes / (R) Rear Tyre - Crack, Cut - Yes / (L) Front Tyre - Crack, Cut - Yes / (L) Rear Tyre - Crack, Cut - Yes / (L) Front Fender, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Front Windshield - Damaged - Repair mark</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>possible flooding/ signal light issue/ missing radio/ no warranty booklet/ no jack / flat tires/no tools/ plate light issue/ with spare tire and LTO plate/</p>