

General Information

Date & Time: 28, Oct, 2025 15:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	9,657
Registration No.	DBF6349	Chassis No.	PA1B18F31R4246068
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



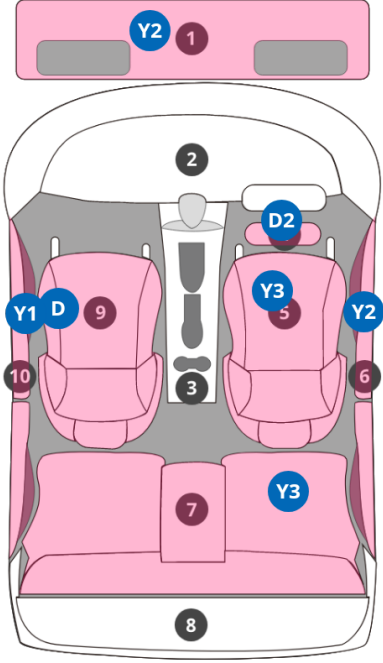
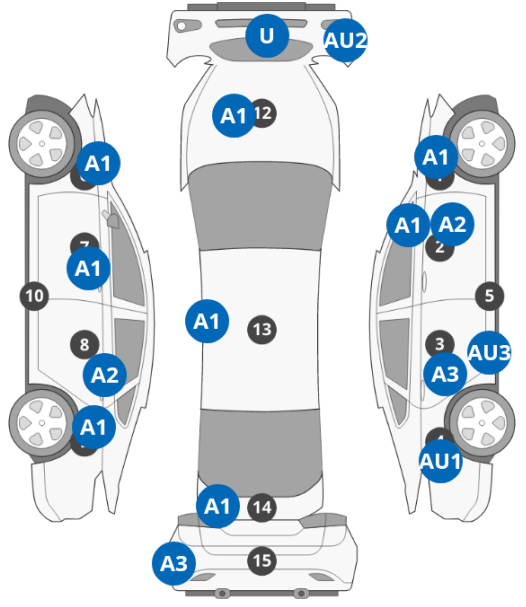
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	117	119	113
2	Boot Lid	123.0	125	116	128
3	Roof	113.7	116	115	112/112
4	Left Front Fender	105.3	100	102	114
5	Left Front Door	106.0	107	103	108
6	Center Panel Left				
7	Left Rear Door	115.3	112	131	103
8	Left Back Panel	120.6	122	117	123
9	Right Front Fender	106.3	112	105	102
10	Right Front Door	104.0	105	104	103
11	Center Panel Right				
12	Right Rear Door	115.6	106	110	131
13	Right Back Panel	115.3	118	109	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratched and cracked tail light</p>