

General Information

Date & Time: 24, Oct, 2025 13:22

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	34,194
Registration No.	DBH7272	Chassis No.	PA1B18F34P4208749
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



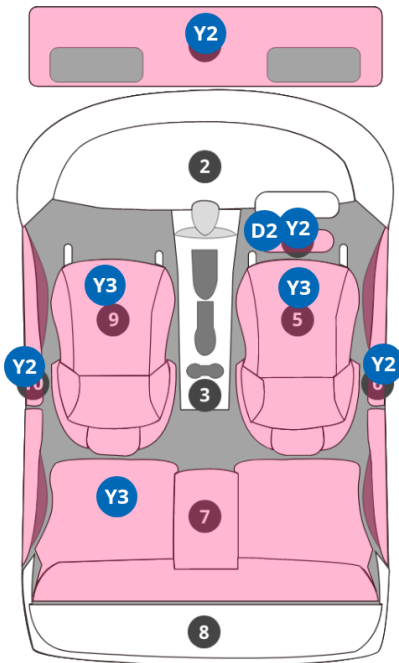
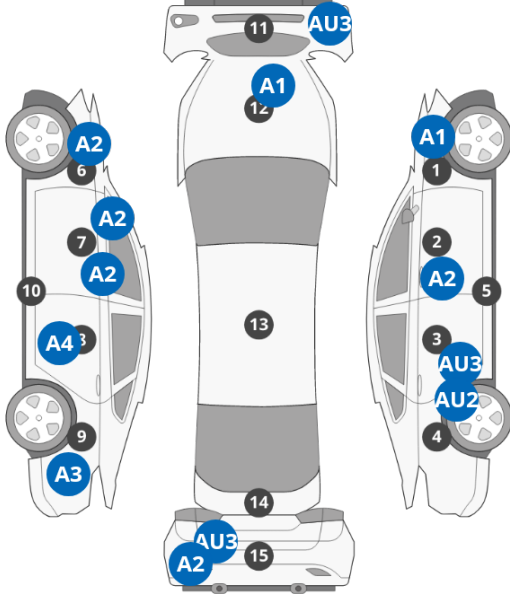
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	111	109	105
2	Boot Lid	104.0	100	103	109
3	Roof	93.1	98	91	87/97
4	Left Front Fender	100.0	94	94	112
5	Left Front Door	95.3	95	92	99
6	Center Panel Left				
7	Left Rear Door	98.1	100	95	99
8	Left Back Panel	102.4	106	102	99
9	Right Front Fender	100.1	101	99	100
10	Right Front Door	104.1	98	113	101
11	Center Panel Right				
12	Right Rear Door	100.2	102	99	100
13	Right Back Panel	106.6	101	108	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet, jack and seat cover. Without spare tire. Incomplete tools. 1 key. With LTO plate.</p>