

General Information

Date & Time: 04, Nov, 2025 10:47

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	11,450
Registration No.	DBT9401	Chassis No.	PAHACACA2S6124310
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



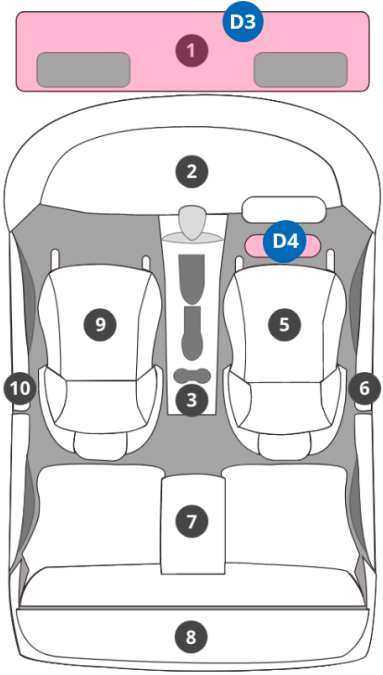
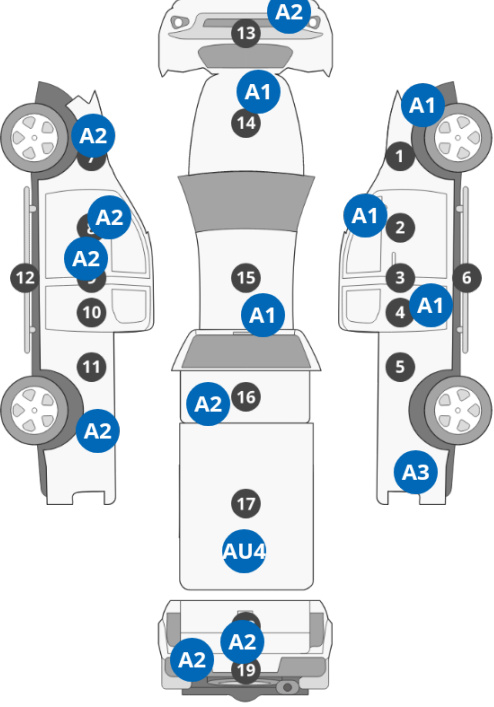
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.8	99	100	97
2	Boot Lid	84.0	60	43	149
3	Roof	112.7	122	127	102/100
4	Left Front Fender	100.8	93	97	113
5	Left Front Door	99.1	95	103	99
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	57.3	58	59	55
9	Right Front Fender	98.9	109	95	93
10	Right Front Door	96.0	92	100	97
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	60.9	69	64	50

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Ceiling - Crinkle - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch - Small / Rear Gate - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, no spare tire, with LTO plate, scratches on tail light</p>