

General Information

Date & Time: 04, Nov, 2025 13:17

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	22,278
Registration No.	NFB9176	Chassis No.	PA1B18F32P4234315
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



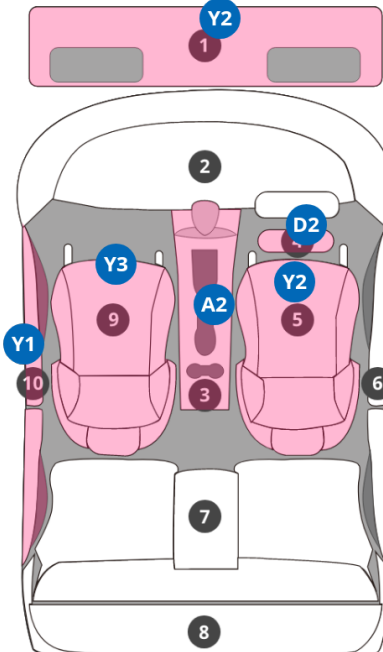
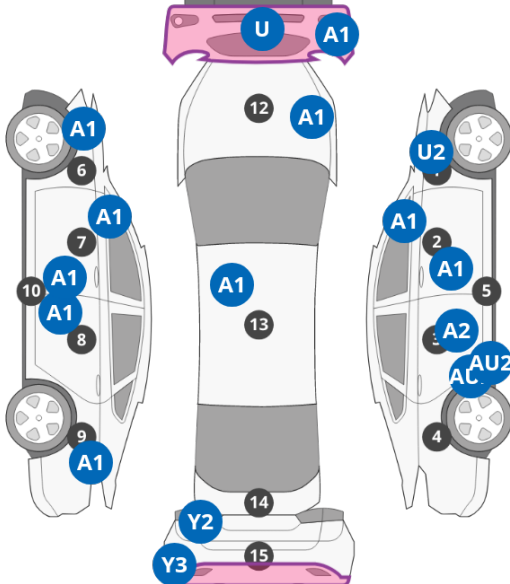
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	117	106	107
2	Boot Lid	105.0	100	105	110
3	Roof	106.5	108	111	100/107
4	Left Front Fender	95.9	98	97	93
5	Left Front Door	101.5	93	115	96
6	Center Panel Left				
7	Left Rear Door	101.1	94	105	105
8	Left Back Panel	100.8	101	107	94
9	Right Front Fender	105.6	103	108	106
10	Right Front Door	100.8	106	100	97
11	Center Panel Right				
12	Right Rear Door	103.2	98	104	108
13	Right Back Panel	107.0	113	102	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Crack, Gap - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>