

General Information

Date & Time: 04, Nov, 2025 16:51

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	10,755
Registration No.	NFR4098	Chassis No.	PA1B18F36R4251895
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



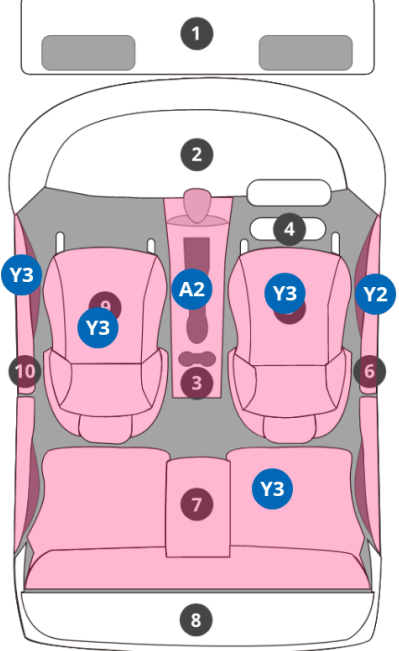
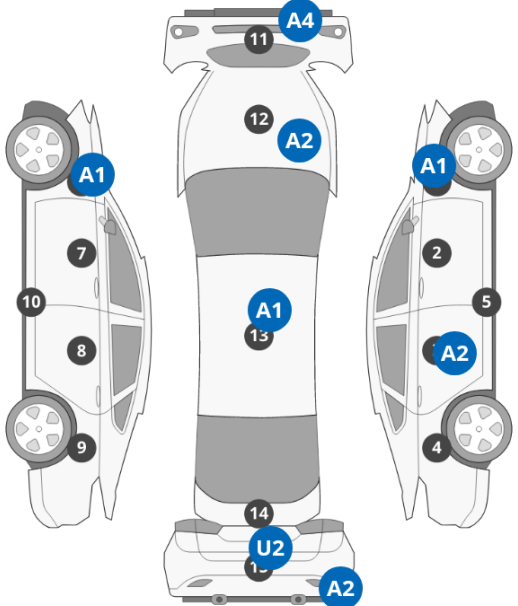
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	130	107	118
2	Boot Lid	102.7	100	93	115
3	Roof	110.2	115	110	109/107
4	Left Front Fender	101.7	99	103	103
5	Left Front Door	104.0	106	103	103
6	Center Panel Left				
7	Left Rear Door	106.6	106	111	103
8	Left Back Panel	117.6	128	114	111
9	Right Front Fender	103.5	111	96	104
10	Right Front Door	106.6	109	104	107
11	Center Panel Right				
12	Right Rear Door	103.6	101	104	106
13	Right Back Panel	110.1	99	114	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with reverse camera/with spare key/with jack and incomplete tools/with warranty booklet</p>