

General Information

Date & Time: 27, Oct, 2025 15:27

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,010
Registration No.	NGC9683	Chassis No.	PA1B18F38R4240669
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



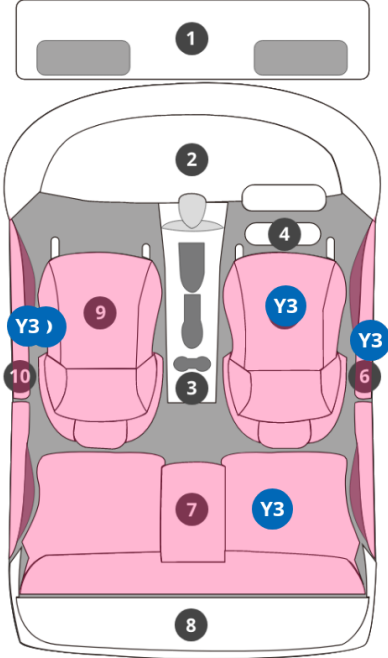
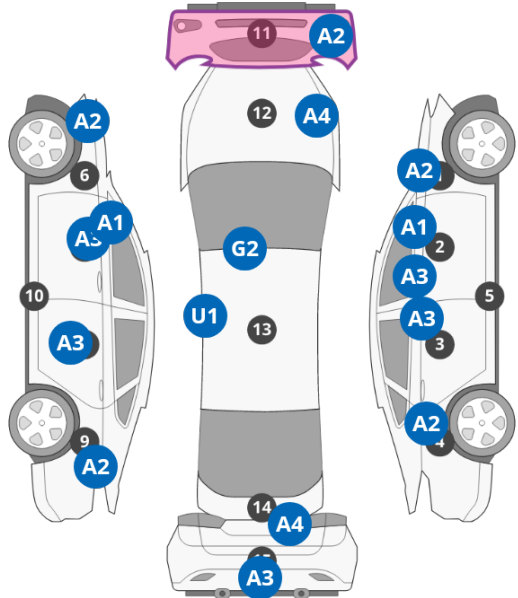
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	107	101	115
2	Boot Lid	104.4	106	97	110
3	Roof	93.7	106	88	91/90
4	Left Front Fender	98.7	97	98	101
5	Left Front Door	101.3	97	104	103
6	Center Panel Left				
7	Left Rear Door	99.0	101	105	91
8	Left Back Panel	142.4	165	164	98
9	Right Front Fender	99.8	99	102	99
10	Right Front Door	99.6	106	97	96
11	Center Panel Right				
12	Right Rear Door	96.5	89	96	105
13	Right Back Panel	102.8	96	100	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium</p>		<p>Remarks (L) Rear Fender - Repair Traces - Yes / Front Windshield - Scratch, Stone chip - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Large / Roof - Dent - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
no warranty booklet, with jack and tools, no spare tire, with LTO plate, scratches on tail light, fog lamps issue