

General Information

Date & Time: 28, Oct, 2025 18:02

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	6,739
Registration No.	NIP5861	Chassis No.	PA1B18F30P4226634
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



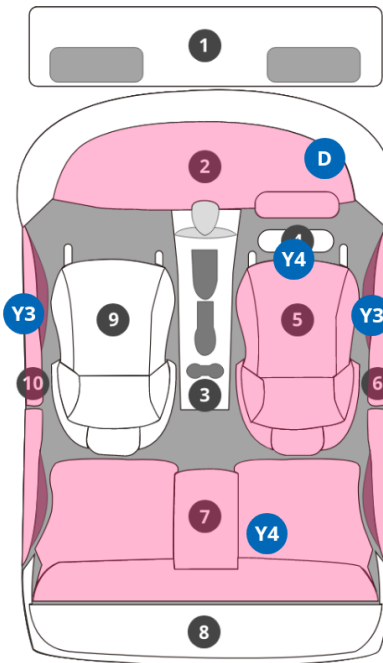
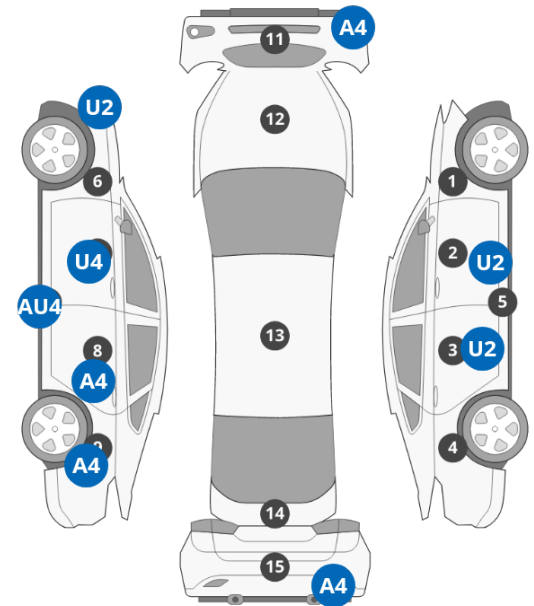
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	109	124	113
2	Boot Lid	111.6	108	112	115
3	Roof	103.6	103	100	102/110
4	Left Front Fender	112.3	117	114	106
5	Left Front Door	122.0	118	112	136
6	Center Panel Left				
7	Left Rear Door	116.6	127	115	108
8	Left Back Panel	118.3	122	122	111
9	Right Front Fender	99.4	103	95	100
10	Right Front Door	107.6	102	119	102
11	Center Panel Right				
12	Right Rear Door	107.6	111	105	107
13	Right Back Panel	102.3	97	100	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Dent - Large / (L) Front Fender, Molding - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no LTO plate/ no warranty booklet/ with jack and sparetire/ with tools/</p>