

General Information

Date & Time: 29, Oct, 2025 13:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,880
Registration No.	NJA2072	Chassis No.	PA1B18F34R4280800
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



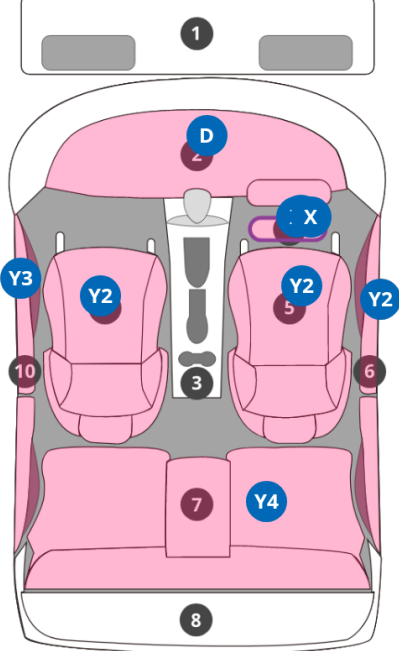
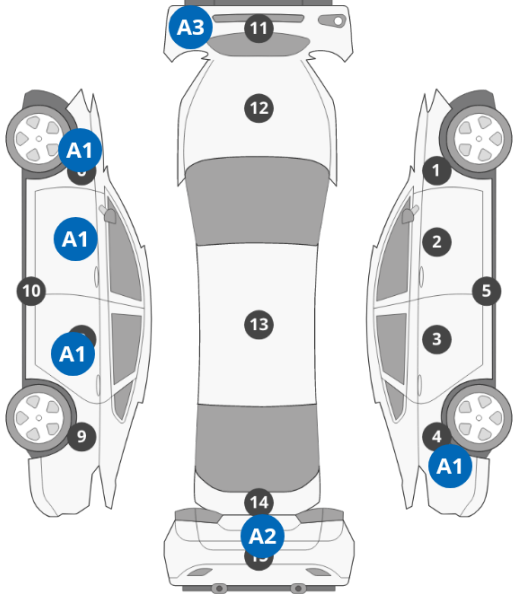
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	136	111	102
2	Boot Lid	106.3	102	106	111
3	Roof	99.9	104	102	93/101
4	Left Front Fender	101.0	100	102	101
5	Left Front Door	102.6	105	102	101
6	Center Panel Left				
7	Left Rear Door	105.3	108	108	100
8	Left Back Panel	110.3	120	109	102
9	Right Front Fender	105.0	106	91	118
10	Right Front Door	125.6	135	116	126
11	Center Panel Right				
12	Right Rear Door	105.7	99	101	117
13	Right Back Panel	106.9	99	102	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

Inspector Notes	
with LTO plate/with spare tire/with jack and incomplete tools/with reverse camera/with warranty booklet/with spare key	